

JAN 2 2 2001

Filed under Remonumentation Act 345 of 1990

SECTION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Lenawee

(County)


Located In:

Corner Code #



LIBER 1

PAGE 416

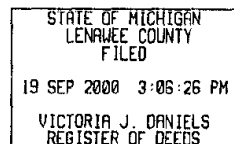

1. Public Land Survey T - 8-S R - 4-E C-13
 T _____ R _____
 T _____ R _____
 T _____ R _____
2. Property Controlling S _____ T _____ R _____
 in Section S _____ T _____ R _____
3. Miscellaneous S _____ T _____ R _____
 Property in Sec S _____ T _____ R _____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Glenn E. Richard, in a field survey on September 8, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

GLO 1819 Joseph Wampler set post corner Sections 31 & 32 Sugar 9 S 41 E 8 R. Oak 11 N 30 W 10
 1914 J.L. Richard "stone and iron underneath"
 1971 I dug and found iron, stone and bricks. I raised it to the surface with a iron pipe
 1973 Found iron pipe in the pavement and recorded it in Liber 2, Page 571.
 1985 I found iron pipe 104.92 East of galv. pipe @ C-1 T9S, R4E
 1995 Michael Bartolo found 3/4" iron pipe and recorded it in Liber 5, Page 249
 1998 Found iron pipe, witnessed and drove down prior to road re-construction

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

July 25, 2000 Found 3/4" X 42" I.P. and bricks. Replaced with 5/8" X 3' re-rod
 September 8, 2000 Found 5/8" re-rod under base course of new asphalt pavement. Capped with Lenawee County Re-mon cap stamped P.S. 13040 and set monument box.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

5/8" X 3' re-rod with Lenawee County Re-mon cap stamped P.S. 13040 in monument box and is accepted as the best available evidence of the position of the original corner.

C-1 T9S R4E West 104.92
 SE corner of concrete porch #3994 N 70° W 114.53
 Dbl. hd. nail & re-mon tag in SE root 36" Maple N 40° W 88.22
 Dbl. hd. nail & re-mon tag in W. face E. pole N 10° E 146.87
 Fd. nail & disc in E. face 40" Maple S 60° W 153.24
 NW corner of conc. block building S 80° W 189.41



Ratified by Peer Group in accordance with P.A. 345 Co. Rec. Glenn E. Richard Date August 22, 2000

Signed by Glenn E. Richard Date Sept. 15, 2000
 Glenn E. Richard

Surveyor's Michigan License No. 13040