

**FEB 23 2001**

**LAND CORNER RECORDATION CERTIFICATE**

Filing Requirement of Act 74, Mich. P.A. 1970  
Luce County Remonumentation Corner

For corners in

Luce County

Located in:

Corner Code #

- |                                    |   |           |               |
|------------------------------------|---|-----------|---------------|
| 1. Public Land Survey              |   | T45N R10W | I-4/5 (South) |
|                                    |   | T         | R             |
|                                    |   | T         | R             |
|                                    |   | T         | R             |
|                                    |   | T         | R             |
| 2. Property Controlling in Section | S | T         | R             |
|                                    | S | T         | R             |
| 3. Miscellaneous Property in Sec.  | S | T         | R             |
|                                    | S | T         | R             |
- #008
4. Lot No. , Recorded Plat
5. Private Claims

REGISTER OF DEEDS  
Recorded  
Liber 3 page 964  
02-12-2001 09:47:51  
Kathy S. Mahar, Register  
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

I, Keith R. Waters, in a field survey on November 6, 2000 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

I-4/5 (South) Witness Corner to the Meander Corner Common to Sections 10 & 11, T45N, R10W, on the South Side of Twin Lakes.

1849 - Original corner established by William Ives, 17.50 chains (1155 feet) north of the section corner at I-5.

Witnesses: Cedar 10, N87°W 12 links - Cedar 10, S12°E 13 links.

Found no evidence of subsequent restoration of this corner.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

This corner is being reestablished as part of the Luce County Remonumentation Program.

Found no evidence of the original corner. Reestablished corner 1112 feet north of the Section corner at I-5, on line between said Section corner at I-5 and the reestablished meander corner on the North side Twin Lakes. This position is 46.6 feet south the pro-rated position for the meander corner, which now falls in Twin Lakes.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed a 1/2" x 36" rebar with a stamped aluminum Luce County Remonumentation cap at the corner location, which falls on the northeasterly shore of the southerly peninsula of Twin Lakes.


Witnesses:

Nail and plastic witness tag #33142 in blazed 14" Cedar, N18°E 28.99'

Nail and plastic witness tag #33142 in blazed 7" Cedar in clump, N73°W 18.44'

Nail and plastic witness tag #33142 in blazed 13" Cedar, S70°W 14.79'

Nail and plastic witness tag #33142 in blazed 4" Cedar, S07°E 16.32'

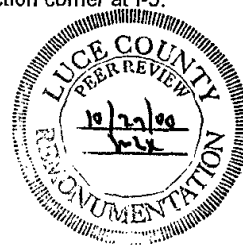

Signed by Keith R. Waters

Date 12-29-00

Surveyor's Michigan License No. 33142

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN. 1983  
REVISED OCT., 1995

T45N R10W I-4-5S

OTHER CODE: 8