LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

OCT 16 11 42 AH 195

or corners in

Property in Sec.

IVINGSTON (County)	Located In:	Corner Code ##
Public Land Survey	T <u>2N</u> R <u>3E</u>	<u>F-13</u>
	T R	
	Υ R	
	T R	
Property Controlling	S T R	
in Section	S T R	
Miscellaneous	S T R	

Τ_

NAMOY HAVILAND REGISTER OF DEEDS : LIVINGSTON COUNTY, HT 48843

L.S.C.# 482m

Register of Deeds Stamp & File Number

_ , Recorded Plat _ Private Claims.


_ R

DARRELL HUGHES, in a field survey on FEBRUARY 22, hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned lines 1 and 2 above were in conformance with regulations and rules therefore as required in the rrent manual of survey instructions of the United States Department of the Interior, Bureau of Land anagement or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 ove were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a urt of Law; established, re-established, monumented, re-monumented, recovered, found as pressed below:

Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

Description of original monument and accessories and/or subsequent restoration:

1825, Sylvester Sibley, Deputy Surveyor Black Oak 32", North 6 degrees West, 86 links White Oak 36", North 75 degrees West, 183 links

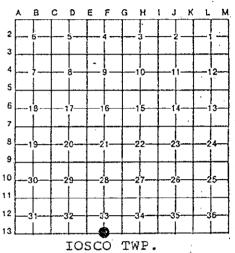

SURVEY & REMONUMENTATION

NOV 27 1995

COMMISSION

Description of corner evidence found and/or method applied in restoring or reestablishing corner: Found 1/2 inch iron rod. Cap No. 13574

*Additional descriptions and historical information on back of this sheet.

Description of monument for corner and accessories established to perpetuate locating the position of the corner:

F-13, T2N, R3E, IOSCO, replaced existing corner with $1-1/4^{\prime\prime}$ X 36" pipe, affixed with 2" dia. brass cap, stamped "Livingsto with 2" dia. brass cap, stamped "Livingston Corner, P.S. 19834, and is accepted as a careful Co. Monumentation faithful reestablishment of the position of the original corner.

270 DEG. 249.97' TO F-1, T1N, R3E, FOUND IRON PIPE/33971.

132 DEG. 54.53' SET NAIL N/S UTILITY POLE.

246 DEG. 15.74' SET NAIL NW/S 30" OAK.

283 DEG. 23.82' SET NAIL S/S 10" MAPLE.

320 DEG. 28.80' SET NAIL NE/S 16" MAPLE.

269 DEG. 2.72' FD. 3/4" ARON PIPE/33971.

⊒ned by . 9834 rveyor's Michigan License No.

Date October 5,

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971 REVISED MAY 14, 1975

វិត្តសមាន (្ Hisbert

700 (18)

IOSCO TOWNSHIP, T2N, K3E

F-13, SOUTH 1/4 COR. SEC. 33

FIELD 02-22-1994, Darrell D. Hughes and Associates

Found 1/2" iron rod with cap # 13574 (Oscar Boss), witness' check Barnwell (P.12)
GPS- Northeast open, Northwest and South treed. poor for GPS.

with the said the

1825 Sylvester Sibley, U.S. Deputy Surveyor, "West on South boundary Sec. 33, 40.00 chains, set 1/4 post". (P.7)

1841/1871 Amos Adams and Miles Bullock, county surveyors show related info. in Sec. 4, Unadilla. (P.8-9)

1897 Miles Bullock witness (P.10)

1972 Oscar Boss finds 1/2" iron and files Act 74. Survey related to the filing does not show corner. L.603, P.01, (P.11-11A)

1991 - Mary Barnwell surveys Northeast 1/4 of Section 4, Unadilla, finds Boss iron, creates new witness'. (P.12)

1991 Barnwell surveys other lands for Butler, shows 1/2 mile distances. (P.13)

1994 Hughes surveys in Southwest 1/4 Sec. 34, Iosco, finds Boss iron and checks Barnwell witness'. (P.14)

1995 Hughes runs traverse to all 1/2 mile corners in Section 33 for check measurements. See handout drawing.