

53

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Mackinac

(County)

Located In:

Corner Code #

1. Public Land Survey

T___ R___
T___ R___
T___ R___
T___ R___

2. Property Controlling
In Section

S 10 T 44N R 11W 12
S 10 T 44N R 11W 14

3. Miscellaneous
Property in Sec.

S___ T___ R___
S___ T___ R___

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

14 May 14 1996

12 May 16 1996

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

(12-Sec. 10) South 1/16 corner, Section 10. Corner not established in the original survey. Found no subsequent record.

(14-Sec. 10) South 1/16 corner between Sections 10-11. Corner established in 1984 by Gerald L. Wiggins, RLS. Corner monumented with a 1" pipe capped with a 4" dia. aluminum MDNR tablet and the following witnesses: 12" R. Maple N37E 15.25', 14" H. Maple N85E 32.60', 14" H. Maple S52E 34.60, 6" R. Maple N78W 37.50', 2" pipe, buried, N08E 6.1'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


(12-Sec. 10) Found no monumentation at the corner position. Established the corner midway and on a straight line between Center of Section 1312.21' north and 1/4 corner 1312.21' south. At the position for the corner, I placed a 1" IDx36" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed by T.Stark and D.Lampela, Newberry.

(14-Sec. 10) Found the 1984 monument, in good condition, at record bearing and distance from the remaining 1984 accessories. The 14" H. Maple N85E has been cut. Placed measuring nails in the remaining witness trees, and marked one new tree as described below. Corner re-witnessed by T.Stark and D.Lampela, Newberry.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(12) Set a 1" pipe with 4" MDNR cap.
Blazed, scribed, and set measuring nails in the following:
6" Cedar South 11.55' "S1/16 BT"
8" Cedar S50W 9.95' "S1/16 BT"
10" Cedar North 6.5' "S1/16 BT"
12" Cedar N55E 14.1' "S1/16 BT"
Placed a squared and scribed cedar post adjacent. Bearings are magnetic.

(14) Found 1" pipe with 4" MDNR cap.
The 1984 witnesses:
14" R. Maple N37E 16.25'
16" H. Maple S52E 35.0'
6" R. Maple N78W 37.5'
New witness:
6" Maple N34W 31.15' "S1/16 NBT"
Placed a squared and scribed cedar post adjacent. Bearings are magnetic.

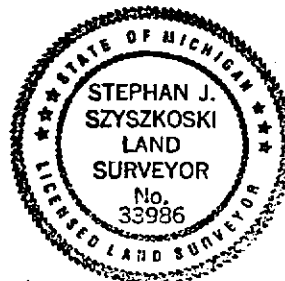

Signed by

Stephan J. Szyszkoski

Date

6/25/96

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1985