

SURVEY & REMONUMENTATION

JAN 23 2001

SECTION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners In: Located In: Corner Code #
Mason County

1. Public Land Survey T 17N R 17W I-9
T R
T R
T R
2. Property Controlling S T R
in Section S T R
3. Miscellaneous S T R
Property in Sec. S T R

FILED
AT 4:16 O'CLOCK P. M.
OCT 9 2000
MARGARET KOLASKI ELLIOTT
MASON COUNTY
REGISTER OF DEEDS
Register of Deeds Stamp & File Number

4. Lot No. Recorded Plat
5. Private Claims

Kenneth L. Ross in a field survey on September 21, 2000, Do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

Section corner common to sections 22, 23, 26 and 27 of T17N, R17W

A. Description of original monument and accessories and/or subsequent restoration:

GLO Hodgson 1838
"corner in lake" set meander post
Beech 7" S65W 44 lks. (29.04') #1
Pine S26E 24 lks. (15.84') #2

Towns Mar., 1911 B4, P30
"planted stone"
No witnesses given

Stephens 1958 & 1959
Unrecorded surveys
"existing pipe"
no witnesses

W.H. Read B2 P302&303
October, 1925
Reestablished this corner from witness
by Mitchell in 1922
Set 1" x 24" pipe (cor. just in lake)
6" S. maple S29E 44' #3
15" S maple S73W 28.8 #4

Stephens RLS 7318, 1968
Set 3/4" pipe in lake from prior survey
3/4" pipe 26.00 ft. West on Section line #5
2" Maple S86W 45.73' #6
3" Birch S32W 13.72' #7

Ross RLS 17634, 1973, 1975 and 1977
Unrecorded surveys
"Cor. in Lake"
3/4" pipe W. 26.00 on Sec. line #5
12" Maple S86W 45.73' #6
3" Birch S32W 13.72' #7

Hays RLS 25847
Unrecorded survey 1990
"corner in Lake"
No witnesses or reference

Nordlund RLS 16345
Unrec. survey 1999
No ref. or witnesses

MCRC (undated)
15" maple S17W 19' #7
6" maple S29E 29' #8

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found a 1/2" iron rod touching the east side of a 3/4" pipe 5' from the shoreline into the lake. The 1/2" iron was 6" below the surface of the ground and the 3/4" pipe was 1' below the ground surface. I left the corner as I found it and added witnesses.

The condition of the witnesses is as follows: 1 through 4 are gone, 5 is in good condition and 6 through 8 are gone.

I found nothing to dispute the location of this corner.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I left the 3/4" pipe as I found it as a substantial marker for the position of the corner. I accepted this as a careful and faithful reestablishment of the position of the original corner.

Existing 3/4" pipe West 26.18' #5
12" maple S26W 34.98 (ex. 60d nail in West side) #9
Set Harrison Monument 21.09' South of corner position stamped "REF. COR. 21.09' North" #10
Set 4" x 36" concrete monument West on section line 34.88' #11

Signed by Kenneth L. Ross Date 10-09-2000

Surveyor's Michigan License No. 17634

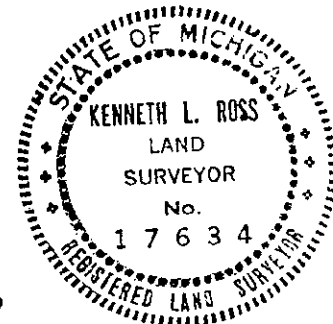

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28,

1971
REVISED MAY 14, 1975
REVISED JAN., 1983
ADAPTED FOR WORD PROCESSING MARCH, 1993

Approved by Peer Review Group on 10-05-2000
Kenneth L. Ross, County Representative [Signature]