

Land Corner Recordation Certificate  
Attachment B to 2016 Annual Grant Agreement  
Authority: MCL 54.205 and R54.202

This form is ONLY for corners filed under the 2016 State Survey and Remonumentation Grant Agreement

Filing Requirement: MCL 54.268(2)(a), 54.268(2)(d), 54.201 – 54.210d and 2016 State Survey and Remonumentation Grant Agreement

- Notes:
- No more than two Original Public Land Survey Corners can be recorded on this certificate
  - If a corner reported hereon is common to two or more survey townships, each Town, Range and Corner Code for the corner may be identified on this certificate
  - If a corner reported hereon is common to two or more counties, each county may be identified on this certificate and a copy of this certificate filed with the Register of Deeds in each county

For corner(s) in: Midland County Edenville & Jerome Twp's.

Corner Type	Survey Township				Corner Code
Original Public Land Survey Corner	T	16N	R	1W	H13
• MCL 54.202(g)	T	15N	R	1W	H1
• MCL 54.262(g)	T		R		
	T		R		
Property Controlling Corner	S		T		R
• MCL 54.202(i)	S		T		R
• MCL 54.262(h)	S		T		R
	S		T		R
Protracted Public Land Survey Corner	T		R		
• MCL 54.202(k)	T		R		
• MCL 54.262(i)	T		R		
	T		R		

1	A	B	C	D	E	F	G	H	I	J	K	L	M	1
2		6		5		4		3		2		1		2
3														3
4		7		8		9		10		11		12		4
5														5
6		18		17		16		15		14		13		6
7														7
8		19		20		21		22		23		24		8
9														9
10		30		29		28		27		26		25		10
11														11
12		31		32		33		34		35		36		12
13	A	B	C	D	E	F	G	H	I	J	K	L	M	13

Part A: Corner(s) History

H13 & H1 – 1830 – GLO – R. Clark, Jr. – Set ½ mile post  
1) Pine 24" N22°W 10 L.  
2) Pine 20" N24°E 22 L.

Part B: Surveyor's Report on Perpetuation or Monumentation of Corner(s)

H13 & H1 – Standard ¼ Corner common to Sec. 34, T16N, R1W and Sec. 3, T15N, R1W – No GLO evidence found.  
Corner falls on N. side E-W gravel road in disturbed area-ditching on the north side of road . Searched for line trees east and west but nothing conclusive found. Set stamped 4" DNR Aluminum cap on 1" x 36" galvanized iron pipe by single proportion on the line of parallel between 'C1 – C13' and 'I1 – I13'. Centerline of E-W gravel road is 25' south. DNR monument accepted as a careful and faithful re-establishment of the position of the original corner.

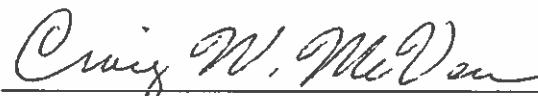
Part C: Field Evidence of Perpetuation or Monumentation of Corner(s)

**H13 & H1** – Standard ¼ Corner common to Sec. 34, T16N, R1W and Sec. 3, T15N, R1W  
Stamped 4" DNR Aluminum cap on 1" x 36" long galvanized iron pipe.  
Set blue composite post 1' east.  
S17°W 60.42' to set nail & tag in W. side 8" Oak  
N84°E 37.09' to set nail & tag in S. side 8" Oak  
N47°E 75.74' to set nail & tag in NW side 22" Oak  
N47°W 54.85' to set nail & tag NE side Twin 6" Red Maple scribed 'XBT'

Date of Observation	Latitude	Longitude	Datum and Adjustment Year	Epoch Date
8/18/2016	N43°43'36.5710"	W84°25'04.5414"	NAD83(2011)	2010.00

Position set by double side shot using 3 control points established using 2 static GNSS baselines to each point from 2 local OPUS base stations adjusted by least squares.

I, Craig W. McVean, in a field survey on Aug. 18, 2016, certify under the requirements of the State Survey and Remonumentation Act, 1990 PA 345, MCL 54.261 to 54.279, and the Corner Recordation Act, 1970 PA 74, MCL 54.201 to 54.210d, that the corner(s) identified and described hereon has been perpetuated or monumented as described in Parts A, B, and C above, pursuant to the laws and rules of the State of Michigan.

  
Craig W. McVean  
Professional Surveyor's License No.: 39088  
Department of Natural Resources, 8015 Mackinaw Trail, Cadillac, MI 49601

12/2/2016

Date



I, Brian D. Ferguson, state that the corner(s) identified and described hereon and perpetuated or monumented as described in Parts A, B, and C above was presented to and reviewed by the Peer Review Group on August 3, 2016 and is accepted for filing in the Midland County Remonumentation Program.

Brian D. Ferguson  
Professional Surveyor's License No.: 26454

Date