

RATIFIED BY PEER GROUP  
PA 345 OF 1990  
MONROE COUNTY, MICHIGAN

date: 8/29/1995

County Rep.:

For corners in  
Monroe (58)

(County)

Located In:

Corner Code #

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

SURVEY &  
REMONUMENTATION

APR 04 1996

COMMISSION

Register of Deeds Stamp & File Number

1. Public Land Survey  
London Twp.

T 5S R 7E

G-11

2. Property Controlling  
in Section

S T R

3. Miscellaneous

S T R

Property in Sec.

S T R

4. Lot No. , Recorded Plat

5. Private Claims

1995 REMONUMENTATION PROGRAM

I, G.B. WARNKE, JR., in a field survey on Aug.-Oct., 1995, 19, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Section Corner common to Sections 27, 28, 34 & 35 / not on road  
1819, GLO Surveyor, J. Fletcher, set wood post - witnesses: B. Oak 9 S10W 14 & Elm 10 N30E 22.  
1972, Kenneth L. Suydam, recorded survey, Liber 636, Page 290, and LCRC, 1, Pages 223-224, to set 3/4" x 24" iron pipe over found 3/8" x 24" rod. 1973, M.R. Fleck recorded survey, Liber 644, Page 965, states F.I.P. 1993, G.B. Warnke, LCRC, Liber 3, Page 307, states Fd. 3/4" iron pipe per Suydam LCRC.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

8/95 - Found 3/4" iron pipe. 8/29/95 - corner was Peer Group approved.  
10/10/95 - G.B. Warnke crew set 1 inch x 36 inch iron pipe with brass cap to replace found iron pipe.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 1 inch x 36 inch iron pipe with brass remonumentation cap and is accepted as the best available evidence of the position of the original corner and witnesses:  
North 10° West 4.31 feet to found nail/shiner in southeast face of 18 inch Catalpa  
North 10° East 30.50 feet to set nail/shiner in South face of 24 inch Oak  
North 85° East 15.65 feet to set nail/shiner in southwest face of a 15 inch Oak  
South 30° West 24.35 feet to set nail/shiner in northeast face of 12 inch Oak


Signed by

Date

12/19/1995

Surveyor's Michigan License No.

19474

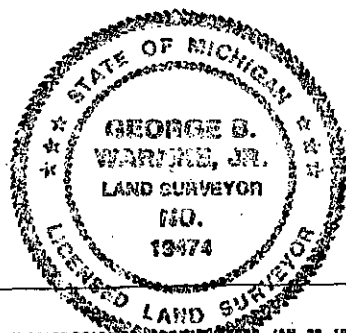

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 197  
REVISED MAY 14, 197  
REVISED JAN., 198