

REM

JUL 03 2000

## SECTION

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970MARQUETTE COUNTY  
MICHIGAN  
RECEIVED FOR RECORD

1996 NOV 22 AM 11:07

Patricia A. Monahan  
REGISTER OF DEEDS

For corners in

Marquette

(County)

Located In:

Corner Code #

## 1. Public Land Survey

T 50N R 29W

K1

T R

T R

T R

T R

2. Property Controlling  
in Section

S

T R

S

T R

3. Miscellaneous  
Property in Sec.

S

T R

S

T R

LUBER R1 PAGE 316  
Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

Oct 02 1995

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

## A. Description of original monument and accessories and/or subsequent restoration:

(K1) Closing corner common to Sections 1-2. Corner established in 1852 by Abner B. Wood: "74.39 Intersect North boundary of township and set post 102 links West of qr. Section corner on South side of Sec. 32 T51N-R28W. Sugar 10 S60E 47, Sugar 8 S43W 28". Found no subsequent record.

## B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(K1) Original post and accessories not recovered. Found no acceptable evidence of the position of the original corner on the ground. Reestablished the corner on a straight line between standard corners at the south 1/4 corner Section 32 T51N-R28W and the Southwest corner of Section 32 T51N-R28W, and at record distance west of the quarter corner. At the position for the corner, I placed a 1"IDx32" iron pipe capped with a 4" dia cast aluminum MDNR tablet, appropriately stamped.

RATIFIED BY PEER GROUP  
P.A. 345 OF 1990Larry J. Bussome  
DATE 10/28/96

## C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(K1) Set 1" pipe with 4" MDNR cap.  
Blazed and scribed the following new bearing trees:

9" Sugar N32W 22.8' "S32 N8T"

8" Sugar N17E 42.6' "S32 N8T"

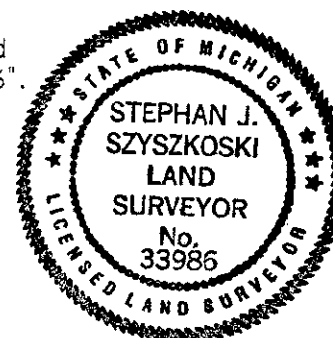
9" Sugar S71E 36.4' "S1 N8T"

9" Sugar S15W 18.7' "S2 N8T"

Bearings are magnetic.

MDNR monuments are 1"IDx32" iron pipe capped with a 4" dia. cast aluminum Michigan Department of Natural Resources tablet, stamped with Township, Range, corner ID, date of placement, and "PS 33986".

New bearing trees are marked with a 8H blaze and a lower blaze at the root crown. The blazes are scribed as indicated in quotation marks at left, with N8T or 8T (as noted) being on the lower blaze. Distances are horizontal (unless noted) and measured from the corner to the inside of a notch cut into the bottom of the lower blaze.

Signed by Stephan J. Szyszkoski  
Surveyor's Michigan License No. 33986Date 11-5-96

For the Michigan Department of Natural Resources - Forest Management Division

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1983  
REVISED OCT., 1995