APR 0 6 1935

@[#		1.		1	3	٠	
	. 8	4	à	١.	ż	i	÷,

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

Approved by	Menomines County
	Remonumentation
Peer Group	Under Act 345 Of

Peer Group Under Act 345 Of			
P.A. Of 1990, On	2/14 198		
MAL	MAINI RCC		
(Chairman		
PAGE # 745, BKS BARBARA MORRISON REGISTER OF DEEDS HENDMINEE, MI 49858	RECEIVED FOR RECORD 99 JAN 27 PM 1: 32		
Register of Deeds St	tamp & File Number		

MENOMINEE	Located In:	Corner Code #
(County)		
1. Public Land Survey	T <u>35N</u> R_ TR_ TR_ TR_	26W E-13
Property Controlling in Section Miscellaneous Property in Sec.	S TR S TR S TR S TR	


, Recorded Plat 4. Lot No.

5. Private Claims

(SAME AS CORNER E-01, T34N - R26W)

Aug. 18, 19 98 do hereby state that under , in a field survey on William Lenca requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 comers, all in the same town and range, may be recorded on this certificate.

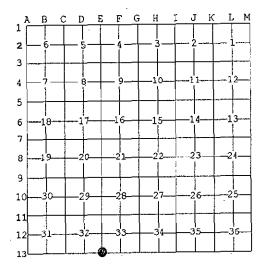

A. Description of original monument and accessories and/or subsequent restoration:

Original Survey by Henry Floyd (Township Boundary) - B.T.'s - Sugar, 12" - N43°E - 23 lks.; Sugar, 15" - N38°W - 43 lks.

All original evidence for this corner has been destroyed by county road improvements.

Original Survey by James H. Mullett (Sectional Subdivision) - B.T.'s - Sugar, 16" - S34°W - 45 lks.; Birch, 10" - S36°E -1848: 24 lks. All original evidence for this corner has been destroyed by county road improvements.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

We found a P.K. Nail in the centerline of County Roads East - West - South and in line with an ancient fence to the North. This location fits existing lines of occupation, and is accepted as the best available evidence of the position of the original corner.



C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

Set 5/8" x 24" Iron Rod/3-1/4" dia. Alum. cap stamped for corner location in Monument Box:

@ Sign Post 29.74 feet $5/8" \times 24"$ Iron Rod/2" dia. Alum. cap marked "WITNESS MARKER" North N630E 68.63 feet 35" dia. Maple (No blazes) Nail in N.W. side 1' E. of Rd. Sign 5/8" x 24" Iron Rod/2" dia. Alum. cap marked "WITNESS MARKER" S52°E 44.98 feet Scr. NBT N510W 62.26 feet 7" dia. Norway Pine North 30.2 feet Metal Survey Sign Post

NOTE: All bearings are magnetic bearings. All distances are measured with steel tape. Distances to trees are to nail in side of tree.

Signed by William Inch	Date Aug. 25, 1998
Surveyor's Michigan License No. 26461	