

# SURVEY & REMONUMENTATION

JAN 09 2001

SECTION

## LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

Approved by Menominee County  
Land Survey Remonumentation  
Peer Group Under Act 345 of  
P.A. Of 1990 On 7/13, 2000  
Mike Annis RLS  
Chairman

For corners in  
MENOMINEE

(County)

Located In:

Corner Code #

1. Public Land Survey

T<sup>35N</sup> R<sup>25W</sup> F-11

2. Property Controlling  
in Section


S T R

3. Miscellaneous  
Property in Sec.

S T R

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

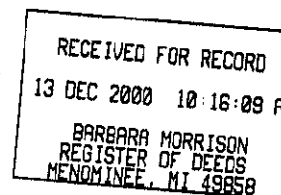

Register of Deeds Stamp & File Number

I, William Lenca, in a field survey on May 31, 1900 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

| A  | B  | C | D  | E | F  | G | H  | I | J  | K | L  |
|----|----|---|----|---|----|---|----|---|----|---|----|
| 1  |    |   |    |   |    |   |    |   |    |   |    |
| 2  | 6  |   | 5  |   | 4  |   | 3  |   | 2  |   | 1  |
| 3  |    |   |    |   |    |   |    |   |    |   |    |
| 4  | 7  |   | 8  |   | 9  |   | 10 |   | 11 |   | 12 |
| 5  |    |   |    |   |    |   |    |   |    |   |    |
| 6  | 18 |   | 17 |   | 16 |   | 15 |   | 14 |   | 13 |
| 7  |    |   |    |   |    |   |    |   |    |   |    |
| 8  | 19 |   | 20 |   | 21 |   | 22 |   | 23 |   | 24 |
| 9  |    |   |    |   |    |   |    |   |    |   |    |
| 10 | 30 |   | 29 |   | 28 |   | 27 |   | 26 |   | 25 |
| 11 |    |   |    |   |    |   |    |   |    |   |    |
| 12 | 31 |   | 32 |   | 33 |   | 34 |   | 35 |   | 36 |
| 13 |    |   |    |   |    |   |    |   |    |   |    |

A. Description of original monument and accessories and/or subsequent restoration:

- 1848: Original Survey by James H. Mullett - B.T.'s - Tamarack, 6" - N31°E - 09 lks.; Tamarack, 16" - N47°W - 10 lks. All original evidence for this corner has been destroyed by logging activities.
- 1970: L.C.R.C. No. 740, Volume 3, by Frank J. Bray, RLS, states that a 1" iron pipe with 4" alum. cap was placed on line and midway between section corners to the east and west. B.T.'s: 9" Aspen - N32°W - 7.6'; 11" S. Maple - S53°W - 6.0'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

We recovered a 1 inch diameter iron pipe with a 4 inch diameter aluminum cap along with 2 B.T.'s as described in L.C.R.C. No. 740 (see part A). The corner fits well with a single proportional location, and is accepted as a careful and faithful reestablishment of the position of the original corner.



C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

Accepted Existing 1-1/2" dia. Iron Pipe/4" Alum. Cap stamped for corner location.

|                           |       |            |          |
|---------------------------|-------|------------|----------|
| 10" dia. Black Ash        | N11°E | 26.66 feet | Scr. NBT |
| 9" dia. Maple             | S25°E | 18.80 feet | Scr. NBT |
| 18" dia. Maple (Ex. B.T.) | S53°W | 6.52 feet  | Scr. NBT |
| 12" dia. Maple            | N69°W | 38.09 feet | Scr. NBT |
| Metal Survey Sign Post    | East  | 0.75 feet  |          |

NOTE: All bearings are magnetic bearings. All distances are measured with steel tape. Distances to trees are to nail in side of tree.

Signed by William Lenca  
Surveyor's Michigan License No. 26461

Date June 30, 2000