## **SURVEY &** REMONUMENTATION

JAN 09 2001

SE	CT	ION
-		X 1 2 1 1

4. Lot No.

5. Private Claims

recovered, found as expressed below:

## LAND CORNER RECORDATION CERTIFICATE Filina Requirement of Act 74, Mich. P.A. 1970


Approved by Menominee County Land Survey Remonumentation Peer Group Under Act 345 of P.A. Of 1990 On 22/22, 20 00 Chairman					
BR. 6 Pg. 222					
RECEIVED FOR RECORD 28 DEC 2000 2:31:31 PM					
BARBARA MORRISON REGISTER OF DEEDS MENOMINEE, MI 49858					
Register of Deeds Stamp & File Number					
ABCDEFGHIJKL					
-654321-					

For corners in MENOMINEE		ing requirement of ACL
(County)	Located In:	Corner Code #
1. Public Land Survey	T <sup>39N</sup> R T R T R	25W I-09
Property Controlling     in Section     Miscellaneous     Property in Sec.	S TR S TR S TR S TR	

, Recorded Plat

William Lenca 19 00 Aug. 14 in a field survey on do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented,

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

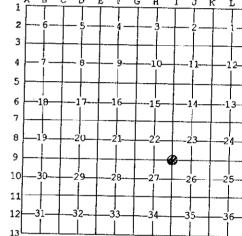

LEDICA

TENED LAND

REVISED OCT., 1995

A. Description of original monument and accessories and/or subsequent restoration:

Original Survey by George E. Adair - B.T.'s - Cedar, 10" - N45°E - 0.21 chs.; Tamarack, 15" - S24°W - 0.16 chs. All 1848: original evidence for this corner has been destroyed by county road improvements.

L.C.R.C. No. 739 (Book 3) by William Lenca, RLS No. 26461 - Set RR Spike in centerline of Co. Rds N - S - E. This 1986: position fits well with corners North & South - TIES: PP - N08°E - 278.74'; PP - S55°E - 47.10'; Anchor Pole - S51°W -41.14'; Basswood, 8" - N770W - 41.85'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

We found a Railroad Spike in the centerline of county roads running North - South and East, along with the Ties as described in part "A" above. The measurement from this corner to the 1/4 Corner North is 2642.36 feet. Measuring South from this location, we find an old fence running West at a distance of 1321 feet and an old fence running West at a distance of 2640.5 feet.

We accepted the location of the railroad spike as the best available evidence of the position of the original corner. G OF MICHIGA

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner: Set 5/8" x 24" Iron Rod/3-1/4" dia. Alum. cap stamped for corner location in Monument Box:

5/8" x 24" Iron Rod/2" dia. Alum. cap marked "WITNESS MARKER" 5/8" x 24" Iron Rod/2" dia. Alum. cap marked "WITNESS MARKER" 5" dia. Cedar Twin 6" dia. White Ash Metal Survey Sign Post	N53 <sup>0</sup> E S53 <sup>0</sup> E S38 <sup>0</sup> W N47 <sup>0</sup> W S53 <sup>0</sup> E	37.64 feet 47.86 feet 47.23 feet 48.98 feet	1.0' N. of Road Sign 1.0' S. of Power Pole Scr. NBT Scr. NBT
---	--	--	---

NOTE: All bearings are magnetic bearings. All distances are measured with steel tape. Distances to trees are to nail in side of tree.

Signed by Allan Fred  Surveyor's Michigan License No. 26461	DateAug. 19, 2000
---	-------------------