

# SURVEY & REMONUMENTATION

# 941

DEC 07 1994

## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

LIBER 390 PAGE 18

For corners in

Missaukee  
(County)

Located In:

Corner Code #

MISSAUKEE COUNTY MICHIGAN

RECORDED OCT 28 1994 15 P.M.

*Cassidy Flare*  
REGISTER

Register of Deeds Stamp & File Number

1. Public Land Survey T 24N R 7W E-9  
T \_\_\_\_\_ R \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_
2. Property Controlling S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
in Section S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_
3. Miscellaneous S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
Property in Sec. S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_
4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
5. Private Claims \_\_\_\_\_

I, J. Dean Geers, in a field survey on July 24, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

- E-9) 1852 GLO Section post by Whelpley, Deputy Surveyor  
Hemlock 14 S 55 W 2, Hemlock 20 S 43 1/2 E 29, Hemlock 15 N 40 1/2 E 37
- E-9) 1909 Cavanaugh, County Surveyor: Gas pipe in concrete  
Beech 14 S 8 1/4 W 73 1/2, Hemlock 30 S 16 E 78
- E-9) 1978 Mears Engineering, S-1, page 462: Found Pk nail
- E-9) 1978 Wilcox, S-1, page 488, Liber 1, page 559: Found Pk nail
- E-9) 1981 Roser, Liber 1, page 621: Found and accepted Pk nail, drove 3/4" x 18" solid Iron rod in place of Pk

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- E-9) Section corner common to Sections 20, 21, 28 and 29

Found large spike over 3/4" Iron recorded in Liber 1, page 621. This corner is accepted as a careful and faithful perpetuation of the position of the original corner. Corner is  $\pm 7'$  South of East-West road Centerline.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- E-9) Replaced 3/4" Iron with 1/2" Iron and Missaukee County monument in monument box

N 36 W - 59.87 - 8" Red Pine  
N 35 E - 53.70 - 7" Red Pine  
S 05 W - 36.23 - 18" Beech  
S 40 E - 38.29 - 6" Red Pine

Peer Group Reviewed and Approved

Date: 10-26-94  
*J. Dean Geers*  
J. Dean Geers, Missaukee Co. Representative

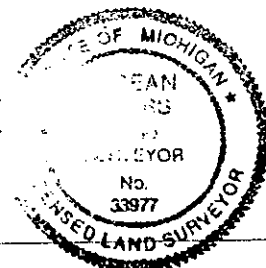

Signed by

*J. Dean Geers*

Date 9/28/94

Surveyor's Michigan License No. 33977