Montmorency County Remonumentation of QUUIZ Page 0225

MAY 1 6 1997

For corners (nOMMAR)

2. Property Controlling

Miscellaneous

Property in Sec.

in Section

LAND CORNER RECORDATION CERTIFICATION

Filing

CORNER RECORDATION CERTIFICATE	STATE OF MICHIGAN
Requirement of Act 74, Mich. P.A. 1970	STATE OF MICHIGAN MONTMORENCY COUNTY
1	Recorded & Filed

MONTMORENCY Located In: Corner Code ## ALBERT TWP. T _29N R _1E_ Public Land Survey T ____ R ____ T ____ R __

_`T ____ R ___

____ T ____ R __

S ____ R __

S

11-06-1996 11:06:16

A. PANGAN-MCELROY REGISTER OF DEEDS


Register of Deeds Stamp & File Number

____, Recorded Plat _____ 4. Lot No. Private Claims _

__ T ____ R .___

I, FREDERICK J. KING in a field survey on May 29 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law: established, re-established, monumented, re-monumented, recovered, lound as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

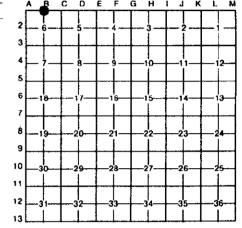

- A. Description of original monument and accessories and/or subsequent restoration:
- B-1 NORTH 1/4 CORNER OF SECTION 6

Not Set on Original Government Survey

Date ? -F.N. Smith #754 - Don Marlatt, P.S.#18660 provided map of area, indicating that Smith had worked in area and Peer Committee felt that he had set this corner. No Corner Description or Witnesses

No Act 74 Found Recorded for this Corner

No Act 132 Found Recorded for this Corner

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
- B-1 NORTH 1/4 CORNER OF SECTION 6

Found Iron & ID Cap #30079 (Phillip D. Case, P.S.) @ Corner B-1

West - 94.70' - Found 3/4" Pipe @ Corner B-13. T30N-R1E N550W - 19.2' - Found Spk SW side of 15" Red Pine

\$80°E - 30.0' - Found Spk N. side of 8" Oak
\$20°W - 9.1' - Found Spk E. side of 6" Maple
N75°W - 40.9' - Found Spk N. side of 12" Maple

Note: Contacted P.D. Case - Would not release any information.

This corner approved by County Peer Review on June 7, 1996, as a careful and faithful establishment of the position of the corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

B-1 - NORTH 1/4 CORNER OF SECTION 6

Placed Montmorency County Re-Mon Cap & 4" Conc Mon @ Fnd I&C Position

N55°W - 19.26' - Set S&T above found Spk - Sw side of 15" Red Pine

S80°E - 30.00' - Set S&T above found Spk - N side of 8" Oak

 $S20^{\circ}W$ - 9.11' - Set S&T above found Spk - E side of 6" Maple N75°W - 40.90' - Set S&T above found Spk - N side of 12" Maple

West - 94.70' Corner B-13 (30-1)

APPROVED BY PEER GROUP

Jun. 07 96

Date _ October 24, 1996

Surveyor's Michigan License No. .

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971 REVISED MAY 14, 197

MICHIGAN

FREDERICK

J. KING PROFESSIONAL SURVEYOR

> No. 25852

POFESSION