

SURVEY & REMONUMENTATION

JAN 22 2001

Liber 00012 Page 0408

SECTION

MONTMORENCY COUNTY REMONUMENTATION LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Located in:

Montmorency
(County)

Briley
(Township)

Corner Code #

STATE OF MICHIGAN
MONTMORENCY COUNTY
Recorded & Filed

10-27-2000 11:55:55

TERESA WALKER
REGISTER OF DEEDS

1. Public Land Survey

T 30N R 2E

E-10

2. Property Controlling
in Section

S

T

3. Miscellaneous
Property in Sec.

S

T

4. Lot No. , Recorded Plat

5. Private Claims

Register of Deeds Stamp & File Number

I, Larry G. Beauregard, in a field survey on MARCH, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules thereof as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

E-10 corner between Sections 28 & 29:

1840 Lewis Clason D.S. Mark Tam. 7" for Qr. Sec. Post.

Date & Surveyor unknown. Set 2" x 2" Cedar stake. No Wit's. Mkd.

1974 Delmer E. Porter P.S. #15410. Fnd. 2" sq. Cedar stake & set 1/2" rod with cap & 3" sq. Cedar stake 8' West of North & South fence line. Filed LCRC Rec. L. 1, P. 108. Wit's. Mkd. (S30°W 14.33' 7" Cedar) (S85°W 51.55' 11" Cedar) (N10°W 14.52' 8" Cedar)

1978 Donald E. Marlatt P.S. #18660. Fnd. corner & prepared Act #132 for parcels in Sec. 28. (Not recorded) No corner description or Wit's. mentioned.

1980 Donald E. Marlatt P.S. #18660. Fnd. 1/2" rod. Filed Act #132 Rec. L. 3, P. 81. Wit's. Mkd. (N20°W 14.57' 8" Cedar) (S60°W 14.41' 8" Cedar) (West 51.73' 12" Cedar)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

March 2000: Fnd. 1/2" rod with cap #15410, 0.7' East of Wood Post, 2± West of 3" x 3" Cedar stake & Wit's. by Porter. Re-placed rod & cap with 4" x 36" concrete monument with a 3/4" aluminum Re-mon. cap on top.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-10 corner between Sections 28 & 29


4" x 36" concrete monument with a 3/4" aluminum Mont. Co. Re-mon. cap.

Accepted the best available evidence of the position of the corner.

Accepted by the peer group on July 18, 2000.

N 08° W 14.42' 7" Cedar
S 88° W 51.55' 11" Cedar
S 48° W 14.33' 9" Cedar
S 73° E 14.09' 6" Cedar

Placed 60d penny spike & P.S. tag #18654 (typ).

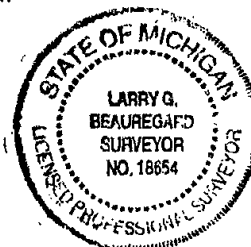

APPROVED BY
PEER GROUP

JUL 18 00 *RLB*

Signed by Larry G. Beauregard

Date 10-27-00

Surveyor's Michigan License No. 18654