

SURVEY & REMONUMENTATION

AUG 22 1995

COMMISSION LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN
COUNTY OF OCEANA
RECEIVED FOR RECORD

100637

95 JUL 10 P2:48

For corners in
Oceana

(County)

Located In:

Corner Code #

1. Public Land Survey

T 13N R 15W

I-9

T R

T R

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

4. Lot No. , Recorded Plat

5. Private Claims

Joseph E. Matthews
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

J. Randolph Hepworth

June 14, 1995

I, in a field survey on 19 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

I-9 Corner Common to Sections 22, 23, 26, 27 T13N, R15W GREENWOOD TOWNSHIP

GLO Set Post 12" W Oak S23°E 24.4 16" W Oak S87°W 19.8 25link stream south 784'

Book A, pg 136; S. Edson, 1881; Corner not described or witnessed

HC Salisbury, 1913; FB#6; Old Stake & Gun Barrel 4" Oak N60°W 50' 28" Pine stump N30°E 61'

LCRC 100246; James Evans, PS22431, 6-15-79; Found 1/2" Iron fits OCRC Witness (new Road Construction)
Conc Proj Marker N35°E 52.25 18" W Oak S60°E 77.57 16", 10" Tw W Oak S45°W 57

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner

I found a 5/8" Iron 6" below the surface in the centerline of a north-south asphalt road. GLO notes do not give a call to leaving the swamp which is approx. 138' south. But the center of the bridge over the creek is at 796' south of this corner (12' long from GLO). Witnesses fit LCRC 100246.

Upon excavation, I discovered that the 5/8" Iron protruded 12" out of a 3/4"x22" Iron Pipe.

Further search of the area failed to yield any other evidence for a conflicting position for the corner. This represents the best available evidence for the position of the corner. The Found 5/8" Iron is accepted as a careful and faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

I-9 Corner Common to Sections 22, 23, 26, 27 T13N, R15W GREENWOOD TOWNSHIP


Set 4"x20" Harrison County Surveyor Monument above the found 5/8" Iron which was driven down.

60d spk S Face	24" W Oak	121°az	77.50	EDM
16d spk S Face	Power Pole	92°az	51.93	EDM
ctr Conc. Hwy Project Marker		37°az	52.20	EDM
PK Nail SE Face	Power Pole	18°az	179.90	EDM
60d spk S Face	6" B Oak	276°az	57.10	EDM
Fd 1/2" Iron, PS30389		271°az	33.07	EDM

Oceana County Remonumentation
Peer Group Reviewed & Approved

Date: 5-25-95

JRH
J. Randolph Hepworth
Oceana County Surveyor

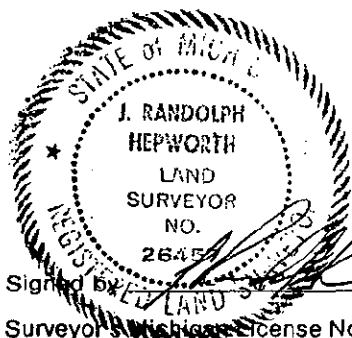

Signed by *JRH*
Surveyor's License No. 26457

Date July 6, 1995