

LAND CORNER RECORDATION CERTIFICATE  
Filling Requirement of Act 74, Mich. P.A. 1970

MAR 02 2001

For corners in

Ontonagon County

Located in:

Corner Code #

SECTION

JUDITH D. ROEHM

1P

Ontonagon County

Page 1 of 1

LC 5/363

JEM Date 01/03/2001

Time 14:37:01

RECORDING FEE:

9.00

1. Public Land Survey

T51N R38W

E-8

T R

T R

T R

2. Property Controlling  
in Section

S

T R

S

T R

3. Miscellaneous  
Property in Sec.

S

T R

S

T R

4. Lot No.

, Recorded Plat

5. Private Claims

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Joseph C. Domitrovich, in a field survey on December 6, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(E-8)-  $\frac{1}{4}$  Corner Common to Sections 20 and 21, T51N, R38W

1846- H. and S.W. Higgins set a  $\frac{1}{4}$  post.

8" Sugar S 25°E 22 links

12" Sugar N 30°W 43 links

1966- C.C. Lindgren P.S. 14098 (For Michigan State Highway Dept.) found a 1" iron pin on a fenceline.

7" Elm N15°E 17.10'

3" Ironwood East 14.05'

8" Elm S 20°E 17.50'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I recovered the 1" iron pin as called for by Lindgren. It fell at the intersection of Fences North, South and East. All of his Bearing Trees have been destroyed. Distance South to Section Corner works reasonably well with Lindgren's and GLO distance. Distance to first stream call to the North works reasonably well with GLO. I have accepted the iron pin as the best representation of the original  $\frac{1}{4}$  corner and have Monumented it as such.

Research on file with County Remonumentation Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 2  $\frac{1}{2}$ " x 30" aluminum pipe with a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION; T51N, R38W;  $\frac{1}{4}$ ; S. 20, S. 21; 2000; P.S. 37273.


Ties:

7" Basswood	S 06°E	22.70'
13" Ash	N 33°E	18.76' (existing Copper Range Loc. Poster)
6" Poplar	N 81°E	37.18'
Steel Sign Rail	East	0.66' (to face)
NW Cor. Sec. 21	N 01°08'10"E	2612.38'
SW Cor. Sec. 21	S 00°01'47"W	2659.78' (2659.78' Lindgren)

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted. Bearings shown between corners are on assumed basis, for reference only.

PEER GROUP APPROVED

Earl W. Applekamp 12-19-00  
COUNTY REMONUMENTATION

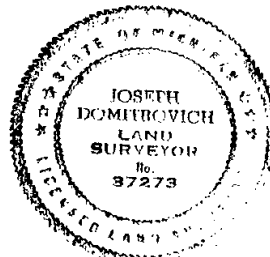

Signed by

J. C. Domitrovich

Date

12/19/00

Surveyor's Michigan License No. 37273