

JUDITH D. ROEHM 1P
LAND CORNER RECORDATION CERTIFICATE Ontonagon County
Filing Requirement of Act 74, Mich. P.A. 1970 of 1

JEM Date 07/10/2000 Time 12:13:35
RECORDING FEE: 9.00

For corners in

Ontonagon County

Located in:

Corner Code #

- | | | | |
|-------------------------|---|-----------|---------------|
| 1. Public Land Survey | | T52N R38W | C - 3 |
| | | T | R |
| | | T | R |
| | | T | R |
| 2. Property Controlling | S | T | R |
| in Section | S | T | R |
| 3. Miscellaneous | S | T | R |
| Property in Sec. | S | T | R |
| 4. Lot No. | | | Recorded Plat |
| 5. Private Claims | | | |

**SURVEY &
REMONUMENTATION**

MAR 02 2001

SECTION

Register of Deeds Stamp & File Number

I, Joseph C. Domitrovich, in a field survey on June 6, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(C - 3) Corner Common to Sections 6, 5, 7 & 8, T52N, R38W.

1846 - S.W. Higgins set a post with ties:

12" Hemlock	S 35°W	46 links
12" Sugar	N 55°E	30 links

1974 - R.S. Scott Engineering Company shows this corner as being a 1" pipe and proposed monument on their Lakeshore Drive R.O.W. Plans.

1977 - Ned Hawley noted in his copy of the original field notes that this corner was a pipe and the Southeast corner of the Joas Farm.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found no remains of the original corner or accessories. I found the pipe called for by R.S. Scott. It had been disturbed by power line clearing. I re-established the original position of the pipe from information from the R.O.W. plans. It falls on an old east-west fence line, on extension of Lakeshore Drive to the North and East. Distances to section corners East and West vary considerably with GLO but this is not inconsistent with work elsewhere by S.W. Higgins. Distances North to Creek calls work reasonably well with GLO. This was a corner of the old Joas Farm which was in existence before 1930. I have accepted the position of the pipe as the best representation of the original section corner.

Research on file with County Remonumentation Representative.

FIELD GROUP APPROVED

Earl W. Applekamp

COUNTY REMONUMENTATION

6-21-00

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 2 1/2" x 30" aluminum pipe with a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION; T52N, R38W; S. 6, S. 5, S. 7, S. 8; 2000; P.S. 37273. Corner falls 7' North of E-W pole line on extension of county road to North and East and 30' South of 2 track road. Ties:


6" Hard Maple	N 01°W	70.45'
14" Hard Maple	S 70°E	65.45'
12" Yellow Birch	South	19.94'
Sign Rail	West	0.98'
SW Cor. Sec. 6	N 87°51'13"W	5216.37' (meas.) 5280 (GLO)
E 1/4 Cor. Sec. 6	N 02°13'20"E	2567.08' (meas.) 2640 (GLO)

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

Signed by *J. C. Domitrovich*
Surveyor's Michigan License No. 37273

Date *6/21/00*

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS JAN 28, 1971
REVISED MAY 14, 1975
REVISED JAN, 1985
REVISED OCT, 1998

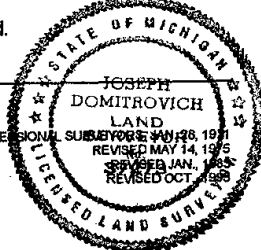

31231