

JUDITH D. ROEHM
LAND CORNER RECORDATION CERTIFICATE Ontonagon County
Filing Requirement of Act 74, Mich. P.A. 1970 of 1

1F

LC 5/321

JEM Date 07/10/2000 Time 12:13:40

RECORDING FEE: 9.00

For corners in

Ontonagon County

Located in:

Corner Code #

- | | | | |
|------------------------------------|------|------|---------------|
| 1. Public Land Survey | T52N | R39W | H - 13 |
| | T | R | |
| | T | R | |
| | T | R | |
| 2. Property Controlling in Section | S | T | R |
| | S | T | R |
| 3. Miscellaneous Property in Sec. | S | T | R |
| | S | T | R |
| 4. Lot No. | | | Recorded Plat |
| 5. Private Claims | | | |

SURVEY & REMONUMENTATION

MAR 02 2001

SECTION

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Joseph C. Domitrovich, in a field survey on June 20, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(H - 13) South 1/4 Corner Section 34, T52N, R39W. * Note: This Corner is Not Common with 1/4 Corner in Section to North. South

August 1845 - William A. Burt set a post with ties:

10" Fir	N 25°E	33 links
12" Hemlock	N 37°W	38 links

I found no record of subsequent restoration.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found no remains of the original corner or accessories. The area around the corner has been clear-cut and the ground scalped for a logging landing. I treated this corner as lost and so re-established it by single proportionate measurement. Corner falls 43.56' west of N 1/4 corner Section 3, T51N, R39W.


Research on file with County Remonumentation Representative.

DEED GROUP APPROVED
Paul W. Applekamp
 COUNTY REMONUMENTATION 6-21-00

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 3/4" x 48" aluminum rod with a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION; T52N, R39W; 1/4; S. 34; S.C.; 2000; P.S. 37273. Ties:

Steel Sign Rail	North	0.62' (to face)
N 1/4 Cor. Sec. 3, T51N, R39W	N 89°54'20"E	43.56'
Northerly Power Pole	S 82°E	299.70'
20" Basswood	S 07°W	104.35'
Southerly Power Pole	S 79°W	306.76'
5" Ironwood	N 68°W	23.89'
SE Cor. Sec. 34	N 89°54'20"E	2643.27'
SW Cor. Sec. 34	S 89°54'20"W	2643.27'

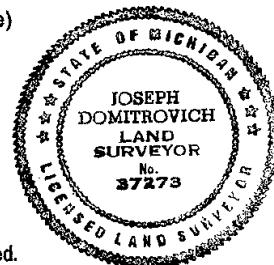

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

Signed by J. C. Domitrovich

Date 6/21/00

Surveyor's Michigan License No. 37273