RECORDING FEE:

9.00

JUDITH D. ROEHM

LAND CORNER RECORDATION CERTIFICATE Ontonagon County
Filing Requirement of Act 74, Mich. P. Jen 970 to 06/12/2000 Tim

LC 5/286 Time 16:30:15

For corners in

**Ontonagon County** Located in: Comer Code # 1. Public Land Survey T52N R39W Т R T R T R R 2. Property Controlling T in Section S T R S Miscellaneous Property in Sec. 2

SURVEY &

MAR 02 2001

SECTION


Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

I, Joseph C. Domitrovich, in a field survey on May 22, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the comer points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 comers, all in the same town and range, may be recorded on this certificate.

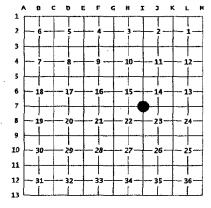

A. Description of original monument and accessories and/or subsequent restoration:

(I - 7) Corner Common to Sections 14, 15, 22 & 23, T52N, R39W. 1845 - William A. Burt set a post with ties:

18" Sugar

S 41°E

25 links

24" Sugar

N 50°W

35 links

1920 (Circa) – E.J. Donnelly, C.E., noted in the copy of the original notes at the Ontonagon County Register of Deeds, that he re-established this position by proportionate measurement (East - West position) and in Centerline of road (North – South position.) He measured 5293.2' from this corner to the SW corner of Section 15.

1950 (Circa) - Ned Hawley, Timber Cruiser, found a spike in highway, N 26°E, 35'5" from a benchmark by Ross Camp.

B. Description of comer evidence found and/or method applied in restoring or reestablishing comer:

I found no remains of the original corner or accessories. Lakeshore Road now runs over corner position. I recovered the SW corner of Section 15 and the U.S.G.S. Benchmark. Using information from Donnelly and Hawley I recreated a position for the Section corner. This position works well with other corners in the area and I have accepted it as the Section Corner.

Research on file with County Remonumentation Representative.

Court STEAM (politary)
ating the position of the comer.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

Corner is a 5/8" x 12" rebar with a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION; T52N, R39W; S. 14, S. 15, S. 22, S. 23; 2000; P.S. 37273. Corner falls on the extension of centerline of Lakeshore Road to the West, and on extension of centerline of old Roadbed to the East. It now falls on the Southerly Edge of paved Lakeshore Road as it curves to the Northeast. I also established a Reference Monument (R.M.) to the South, a 2 ½" x 30" aluminum pipe with a 3" diameter aluminum cap stamped to indicate that the Section Corner is N 02°22'E 26.45'. Ties to the Corner:



21°W 30.16'	
22°E 59.97'	
30°25'29"E 34.80'	(Designation TT11TX - 1937)
02°22'23"W 26.45'	
35°W 33.65'	
00°29'07"W 2663.85	
89°57'52"W 5295.10	' (5293.2' Donnelly)
89°59'59 <b>"W</b> 2662.60	,
	22°E 59.97' 30°25'29"E 34.80' 20°22'23"W 26.45' 35°W 33.65' 20°29'07"W 2663.85 39°57'52"W 5295.10

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.