RECORDING FEE:

9.00

LC 5/317 Time 12:13:38

For corners in

Ontonagon County Located i	n: (Comer Code #
Public Land Survey 2. Property Controlling sin Section S Miscellaneous S Property in Sec. S	T52N R39W . T R T R T R T R T R	J - 13

SURVEY & REMONUMENTATION

MAR 02 2001

SECTION


Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

I, Joseph C. Domitrovich, in a field survey on June 19, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 comers, all in the same town and range, may be recorded on this certificate.

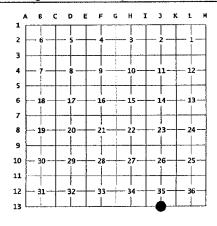

A. Description of original monument and accessories and/or subsequent restoration:

(J - 13) South 1/4 Corner Section 35, T52N, R39W. * Note - 1/4 Corner not common with Section to South.

1845 - William A. Burt set 1/4 section post of Sugar with ties:

14" Sugar 14" Y. Birch N 22°E N 67°W 31 links

I found no record of subsequent restoration.

B. Description of comer evidence found and/or method applied in restoring or reestablishing corner:

At the corner position I recovered the rotted remains of both original bearing trees. The 12" Sugar is now a rotted stump. The 14" Y. Birch is a rotten mound. I re-established the ¼ corner at record GLO from these B.T.s. This position works well with Corners to the East and West and with a painted Blue line to the North. (Blue line also runs south but this ¼ corner is not common with Section to South.

Research on file with County Remonumentation Representative.

Earl W leplekanp

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner

Corner is ¾" x 48" aluminum rod with a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION; T52N, R39W; ¼; S.C.; S. 35; 2000; P.S. 37273. Corner falls in wet ground on the Northerly edge of a power line clearing. Ties:

N 37°E 8.93 14" Soft Maple 26.39' 8" Ash West 56.41 10" Soft Maple N 32°W Sign Rail North 0.65 N 89°52'46"E 41.57 N 1/4 Cor. Sec. 2 (T51N, R39W) N 89°52'46"E 2638.19 SE Cor. Sec. 35 (Stan. Cor.) SW Cor. Sec. 35 (Stan. Cor.) S 89°32'54"W 2623.70' JOSEPH DOMITROVICH LAND LAND SURVEYOR 37273

REVISED OCT., 1995

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

Signed by _

by Jh C. Warm h

Surveyor's Michigan License No. 37273

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971 REVISED MAY 14, 1935 REVISED JAN. 1953