JUDITH D. ROEHM

Page 1 of 1

Ontonason County

LC 57 107

JEH Pec, Date 07/29/98 Time 15:16 LAND CORNER RECORDATION CERTIFICATE IS FEE: Filing Requirement of Act 74, Mich. P.A. 1970

16

For corners in

ONTONAGON Located In: Corner Code# (County) 1. Public Land Survey T48NR 40W 2. Property Controlling in Section 3. Miscellaneous Property in Sec.

JAN 11 1999

SECTION


Register of Deeds Stamp & File Number

4. Lot No,	Recorded Plat	
5. Private Claims		
o. i ilvato Olali 119 _		•
_		

Section Corner common to Sections 17, 18, 19 & 20, T48N R40W.

, Earl W. Applekamp in a field survey on July 02 , 19 98 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate

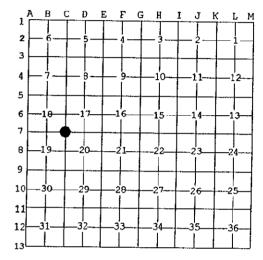

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established by Wells Burt, U.S. Deputy Surveyor, May 24, 1851. Set Wood Post.

ORIGINAL BEARING TREES:

8" White Pine 16" Tamarack

N26°E S27°W 10.56 feet 26.40 feet **ONTONAGON COUNTY** PEER APPROVED

Larl W applekamp 7-22-98 Co. REP.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No original evidence was found. A Township road was established along the East-West Section line about 1915. This road is now abandoned but still very visible. Highway prints dated 1963 indicated a $1\frac{1}{2}$ " pipe was at the corner location. I found this pipe on the Northerly edge of the abandoned 10 foot wide roadway. This position was in agreement with the distance shown on the highway drawings. A fence line runs North and South from this location. I accepted this location as being the only logical position for the corner and monumented it. This corner is in a large swampy and brushy area.

Research on file with the Ontonagon County Remonumentation Program Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

At the corner position I set a $2\frac{1}{2}$ "X30" aluminum pipe with a 3" stamped cap over the $1\frac{1}{2}$ " existing pipe. The cap is stamped to read: County Remonumentation, T48N R40W, S17, S18, S19, S20, 1998, P.S. 17610. I established the following bearing objects.

64.84' - 6' Steel Sign Post East 0.84' Nail in Fence Post North N65°W 112.30' - 6' Steel Sign Post S44°W 13.97' Nail in 3" Aspen

, gra	ME OF MICHIGA	NA.
A LICENSE	EARL W. APPLEKAMP PROFESSIONAL SURVEYOR NO. 17610	THE WEYOR & WINNE

Signed by Earl W	applekan	P
Surveyor's Michigan License No	7 7	17610

July 16, 1998