

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Ontonagon
(County)

Located In:

Corner Code #

10/23/96
16:19
Ontonagon County
LC 4/211 JJI Feet 11.00
Page 1 of 2

1. Public Land Survey

T 51N R 40W

C-2/3 #2

T R

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous

S T R

Property in Section

S T R

4. Lot No. , Recorded Plat

5. Private Claims

SURVEY &
REMONUMENTATION

MAY 22 1997

COMMISSION

Register of Deeds Stamp & File Number

I, Joseph C. Domitrovich, in a field survey on September 25, 1996, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(C-2/3) Meander Corner common to Sections 5 & 6, T51N, R40W

1845 - William A. Burt set post in Mouth of Stream

20" Y. Pine S 65° W 36 links

10" W. Birch S 86° E 1.73 links

19?? - T.H. Wilcox, Supervisor's Plat of Gov't Lots 1 and 2, Section 6, T51N, R40W shows this corner and 1/16 corner and Section corner to the South.

1969 - M.S.H.D. M-64 highway Plans show Angle and distance off of centerline to this corner, 1/16 corner and Section corner to the south. Meander corner was a 1 1/2" iron pipe, 1/16 corner was a 4" square concrete monument and Section corner was a 3/4" iron pipe.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

The original corner and accessories have been obliterated by shoreline erosion. The 1 1/2" iron pipe found by the M.S.H.D. has also been washed out. I found an Ontonagon County Aluminum Monument by Earl Applekamp, P.S., at the Section Corner and a 1/2" rebar over a buried concrete monument at the 1/16 Corner. These corners work well with M.S.H.D. angles and distances and with corners in the plat. I established a Witness Corner to the Meander Corner on line with the 1/16 Corner.

Research on file with County Remonumentation Representative.

PEER GROUP APPROVED

Earl W. Applekamp
COUNTY REPRESENTATIVE 10-16-96

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 3/4" x 72" aluminum rod with a 3" diameter aluminum cap stamped to read: W.C.M.C.; S. 6, S. 5; T.51N, R.40W; 1996; P.S. 37273; COUNTY REMONUMENTATION. Corner falls 7' South of bank of Cranberry River and 129' South of shore of Lake Superior. Witnesses are to this corner (W.C.M.C. #1). Another W.C.M.C. was set on section line and on North R-O-W M-64. W.C.M.C. #2 is a 5/8" x 48" rebar with a 3" diameter aluminum cap stamped same as W.C.M.C. #1.

1' Twin Soft Maple S 68° E 12.29'

W.C.M.C. #2 S 00° 08' 20" E 212.62'

1/16 Corner S 00° 08' 20" E 660.98'

1 1/2" Ash S 31° W 5.00'

3" Tag Alder S 64° W 14.26'

Steel Sign Post North 0.58'


NOTE: Bearings are magnetic. Distances are to nail in side of witness objects unless noted.

Signed by J. C. Domitrovich

Date 10/15/96

Surveyor's Michigan License No. 37273

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983

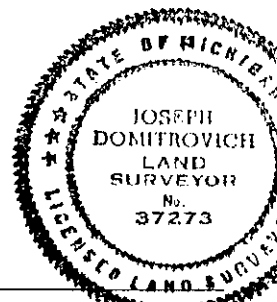

- SKETCH ON BACK -

T51N R40W

