

94

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Schoolcraft

(County)

Located In:

Corner Code #

1. Public Land Survey

T 47N R 13W

14

T 47N R 13W

15

T R

T R

2. Property Controlling

S

T R

In Section

S

T R

3. Miscellaneous

S

T R

Property in Sec.

S

T R

4. Lot No. , Recorded Plat

5. Private Claims

15 Jul 03 1996

14 Jul 18 1996

I, Stephan J. Szyszkoski, in a field survey on 19 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

(14) Quarter corner common to Sections 10-11. Corner perpetuated in 1959 by Billy D. Buckler, RLS: "this corner was replaced from probable B.T., a 36" White Pine stump bearing S74W 37 links. Found some indication of a stake in soil at corner. Corner was placed and witnessed July 7, 1959 with J. Zollner, Assistant District Forester. Placed a 1" pipe with 4" brass cap. Witnesses to corner: 24" White Pine Stump S6E 17 links, 19" White Pine Stump N66W 113.5 links, White Pine Stub N45E 57 links".

(15) Corner common to Sections 10-11-14-15. Corner reestablished in 1959 by Billy D. Buckler, RLS, by double proportionate measurement. Monument placed: 1" pipe with 4" brass cap. Witnesses to corner: 22" White Pine stump N87E 75 links, White Pine root N10W 133 links. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(14) Recovered Buckler's monument, as described, with cap broken and pipe bent over at ground level. All of the 1959 witnesses have been destroyed. Removed the 1959 monument and, at the position of the bottom of the pipe, placed a 1" I.D x 36" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner remonumented by T.Stark and D.Lampela, Newberry.

(15) Recovered Buckler's monument, as described, with cap broken and pipe bent over. Both 1959 witnesses have been destroyed and were not recovered. Removed the 1959 monument and, at the location of it's base, placed a 1" ID x 36" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner remonumented by T.Stark and D.Lampela, Newberry.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(14) Set 1" pipe with 4" MDNR cap.
Blazed, scribed, and set measuring nails
in the following new bearing trees:

9" Red Pine S88E 105.6' "1/4S NBT"

5" Cherry S15W 102.15' "1/4S NBT"

8" Red Pine S39W 115.35' "1/4S NBT"

8" Red Pine N31W 98.35' "1/4S NBT"

Placed a squared and scribed cedar post

adjacent. Centerline of N-S trail is

West 11.0'. Bearings are magnetic.

(15) Set 1" pipe with 4" MDNR cap.

Blazed, scribed, and set measuring nails

in the following new bearing trees:

8" R. Pine S25W 133.0' "S15 NBT"

8" R. Pine S53W 132.6' "S15 NBT"


10" Twin R. Pine S59W 131.7' "S15 NBT"

10" R. Pine N54W 120.7' "S10 NBT"

Placed 5" squared and scribed cedar post

adjacent. N-S trail is 5' west.

Bearings are magnetic.

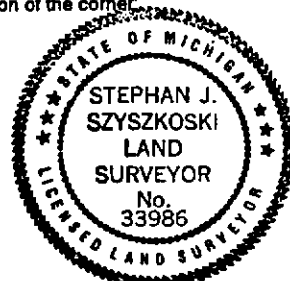

Signed by

Stephan J. Szyszkoski

Date

Jan. 1, 1997

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1973
REVISED JAN., 1983
REVISED OCT., 1985