

SURVEY & MONUMENTATION

DEC 28 2000

SECTION

COPY

RECEIVED FOR RECORD

LIBER NO. PAGE NO.

1994 REMONUMENTATION PROGRAM
LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in ELKLAND TOWNSHIP

TUSCOLA
(County)

Located In:

Corner Code #

VIRGINIA M. McLAREN
TUSCOLA COUNTY
REGISTER OF DEEDS

1. Public Land Survey T 14N R 11E
T R
T R
T R
2. Property Controlling S T R
in Section S T R
3. Miscellaneous S T R
Property in Sec. S T R

M-5

Register of Deeds Stamp & File Number

4. Lot No. Recorded Plat
5. Private Claims

I, Lionel Roy Emery, in a field survey on July 29, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- 1835 (Gov't. Land Office Notes) Harvey Parke, D.S. -Set post corner Secs. 12 & 13- Beech 26 N14W 56; Beech 20 S17W 23
- 1895 (County Surveyor's Record, pages 164 and 165, Sanilac County) M.E. Ward, Surveyor -set by port'l. measurement, stake, brick and glassware- no accessories given.
- 1980 (Survey -Liber 4 of Surveys, page 446, Sanilac County) Stewart G. Case, P.S. 15399 -Fd. 2' by 10" stone held on edge by section of flat iron- Nail NE side T.P., N55°W-43.10'; Nail SW side P.P., S55°E-50.95'; Steel telp. cable marker post, N55°E-43.05'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found two flat stones oriented Northwest/Southeast with $\frac{1}{4}$ " x $1\frac{1}{2}$ " x 14" iron bar between stones, Southwesterly stone 4" thick x 14" x 18", Northeasterly stone $2\frac{1}{2}$ " thick x 8" x 10". Also found pieces of Red Brick and pieces of clear glassware and pieces of pottery at 26" below Gravel surface.

Accepted iron bar and glassware as marking original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- Removed found objects and replaced with Standard Tuscola County Concrete Monument with 2" Brass Cap stamped M5 T14N/R11E
- N40°E, 29.60' -set $\frac{1}{2}$ " diameter reinforcing rod.
- S40°E, 53.34' -T.C. Re-mon. tag above found nail in Southwest face of Power Pole.
- S75°W, 89.66' -T.C. Re-mon. tag in Southeast face of 10" Elm.
- N50°W, 43.11' -T.C. Re-mon. tag above found nail in Northeast face of Telephone Pole.
- Also found nail and washer in Northwest face.


Signed by Lionel Roy Emery
Surveyor's Michigan License No. 24593

Date Oct. 24, 1994

APPROVED

10-24-94

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISOR: MAY 14, 1975
REVISED JAN., 1983

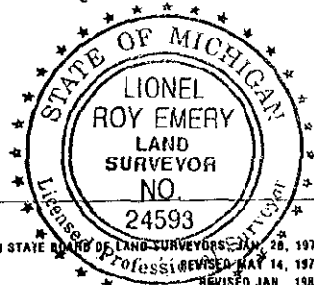

COPY

