MAY - 1 1995

For corners in Washtenaw

(County)

1. Public Land Survey

COMMISSION

	IER RECORDATION CERTIFIED rement of Act 74, Mich. P.A.		EP 2)	ASHTENA
ed In:	Corner Code ##	O REE	= 15	ORC JRO₩
S R 4E	<u>K-12</u>	XEGISTI SERVES	P	EO EO TINTY, M
R		rri 20	Ē	Ξ
R R		LIRER I	PAGE 21	Rm
R		-('	\triangle	_

	Property Controlling n Section		R				118	:R	1	PAGE	21	Rn	7	
	Miscellaneous Property in Sec.		RR				Register	of De	eds S	tamp	& File	Num	ber	
	ot No						2 2 3	B (5 D	E F	G H	1 J	K	<u></u>
do he in line curre Mana above Court	naries C. Wilson reby certify that under res 1 and 2 above were nt manual of survey insigement or by a decree re were in conformance of Law; established resed below:	requirements of P in conformance structions of the U of a Court of Lawa with the rules of t	A. 74, Michiga with regulation United States and/or that the he Michigan B	an P.A. of 1970, the ons and rules the Department of the corner points maded Board of Land St	he corner poir nerefore as re he Interior, Bu nentioned in li urveyors or by	nts mentioned equired in the areau of Land nes 3, 4 and 5 a Decree of 8	6 1 7 5 8	-1819	-17	-16- -21- -28-	-15- -22- -27-	-14		13-13-24-25-
ИОТ	E: Not more than 4 on this certificat		the same to	wn and range	, may be red	corded	12	31		 33	-34-	35	•	36-

Description of original monument and accessories and/or subsequent restoration:

Located L

T 3S

United States Government Survey, 1815 Instructions, Surveyed 1819, Bearing Trees W. O. 12" S12deg.E 27 Links(17.82)

Hick. 9" N71deg.W 14 Links(9.24) Meas. (N) 40 Chains (2640) (S) 40 Chains (2640)

Washtenaw County Road Commission, William J. Armstrong PS# 2444 October 10, 1933

Set Iron Pipe, Stones and Bricks from remaining Bearing Tree 15" Elm N19deg.E 76.7 12" Hickory N54deg E 41.7

14" Apple \$5deg.W 64.95

8" Elm N76deg.E. 103.0 12" Apple S64deg.W 78.5

3 R/W Iron Pipes (S-NW-NE)

Continued on back:

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found a 1/2" (ID)x15" Iron Pipe at the intersection of Steinbach Road N(gravel) and Saline Waterworks Road F-W(gravel), 1" below gravel surface, from the remaining accessories mentioned in Paragraph A. Removed and found a 1-1/2"(ID) Iron Pipe 16" below gravel surface. Both the Iron Pipes are in the same horizontal position. I believe the 1-1/2" from Pipe to be the point set by William J. Armstrong in 1933.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner (K-12) (1-1/2" Iron Pipe, as found, raised with a 1"(ID)x12" Iron Pipe with a Remonumentation Cap stamped #13604, to 4" below gravel surface.

7' N of S edge of gravel surface, on center of gravel surface N'ly
NW comer of Wood Tool shed S50deg.E 52.74 * Stump N78deg.E 141.2 * Utility Pole S30deg.E 22.92 to Nail & RT, E. side *
3/8" Iron Rod N45deg.W 46.50 * 24" Oak N85deg.E 200.40 to Nail & RT S side Steel Post of Road Name & Directional Sign S10deg.E 14.02

24" Shagbark Hickory N5deg.W 175.30 to Nail & RT E side

*indicates accessory previously mentioned in Paragraph A.

Continued on back:

Date


RICHICA Q F CHARLES C WILSON NO 13604 ESS/ONAL 50

Signed by .

May 1, 1994

Surveyor's Michigan License No. 13604

FORM APPROVED BY MICHIGAN STATE BURNDERS SURVEYORS, JAN. 28, 1971 REVISED MAY 14, 1975 REVISED JAN., 1983

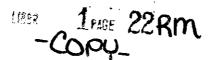

A. Paragraph A. Continued:

Atwell-Hicks, Inc., Survey dated July 26, 1971 Elm Stump N76deg.E 103.0 NW Cor. of Barn S45deg.E 52.7 32" Box Elder N75deg.W 126.5 32" Box Elder N40deg.W 195.5

Washtenaw Engineering Co., Inc.
Norman N. Fahrner, PS# 17620
Act 74 Recordation, Liber 2, Page 273
September 27, 1972
Found 1/2" Iron Pipe 2
28" Ash N76deg, W 127.1
24" Ash N34deg, W 138.5
12" Hickory N78deg, E 141.2
NW Comer of Tool Shed S45deg, E 52.87
Utility Pole S30deg, E 22.60

Midwestern Consulting, Inc., Survey dated November 15, 1978 Allen R. Rentschler PS# 15411 Found 1/2" Iron Pipe NW, Corner of Tool Shed S50deg,E 52.8 Road Sign Post N50deg,E 65.2 Iron Pipe N45deg,W 46.5

C. Paragraph C. Continued

I feel that this corner, as found, is a careful and faithful perpetuation of the position of the original corner

This corner was ratified by the Washtenaw County Peer Committee on January 25, 1994

APPROVED

DATE 1/26/94

CO. REP. 4/2

10 g