

JAN 22 2001

Filed under Remonumentation Act 345 of 1990

## LAND CORNER RECORDATION CERTIFICATE

SECTION

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in



LIBER 2


PAGE 2

Lenawee  
(County)

Located in:

Corner Code #

1. Public Land Survey T-5-S R-2-E L-3  
 T R  
 T R  
 T R
2. Property Controlling S T R  
 in Section S T R
3. Miscellaneous S T R  
 Property in Sec S T R

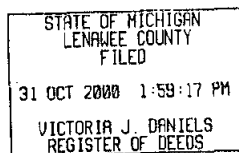

Register of Deeds Stamp &amp; File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
5. Private Claims \_\_\_\_\_

I, Glenn E. Richard, in a field survey on October 25, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

## A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. 1824 Hervey Parke D.S. Set 1/4 Sec. post W. Oak 16 S 81 1/2 E 75 W. Oak 14 N 26 E 121  
 1895 Lenawee County Surveyor James Blair received letter from G. Fargo, Jackson Co. Surveyor that G. Fargo surveyed from the NW corner of section 12 and reestablished the North 1/4 by setting an Oak Stake 1' West of fence & found remains of one government witness tree. A lot of the property descriptions along US-12 give the same distance 1031.91' as the G. Fargo survey between the 1/4 corner and the centerline of Chicago pike but I cannot find any notes that any one ever found the Oak Stake. I also found a 1862 deed that called for it to be 1045.4' and another deed with the distance of 1056'.  
 1930 Atwell Hicks did an extensive survey in Sections 1 and 2. They retraced the GLO survey of the south line of Sections 1 and 2 and the East line of Section 12. They computed locations for L-3 and M-3 but didn't set any monuments.


## B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Jan. 2000 I tied together several traverses I had done in Sections 11 & 12 which included some of the corners shown on the 1930 Atwell Hicks survey as well as the one at the SE corner of the SW 1/4, SW 1/4, Section 1. From these I computed the same location for L-3 that Atwell Hicks did in 1930 which is 1049± north of the center line of US-12. The GLO notes call for the corner 12 lks (7.92') west of edge of prairie. The corner is 0.5± west of N&S line of fence post stubs and 8± west of east edge of swamp.  
 October 25, 2000 Set 30" Harrison monument surrounded by circle of 10" diameter stones

## C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

30" Harrison Monument stamped P.S. 13040 surrounded by circle of stones and is accepted as the best available evidence of the position of the original corner.

dbl hd nail & re-mon tag in 14" W. Cherry N 20° E 32.69  
 dbl hd nail & re-mon tag in 14" pine N 50° E  
 dbl hd nail & re-mon tag in 13" pine S 85° E 19.47  
 dbl hd nail & re-mon tag in 14" pine S 50° E 20.09  
 Carsonite post 0.53 west  
 East edge of swamp East 8±

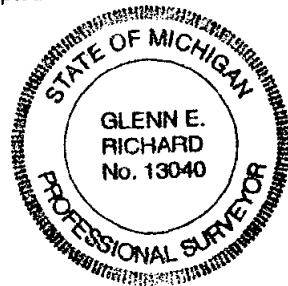

Ratified by Peer Group in accordance with P.A. 345 Co. Reg. Glenn E. Richard Date August 8, 2000

Signed by Glenn E. Richard Date Oct. 30, 2000  
 Glenn E. Richard

Surveyor's Michigan License No. 13040