

JAN 18 2001

## SECTION

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970STATE OF MICHIGAN  
COUNTY OF OCEANA  
RECEIVED FOR RECORD

21 DEC 2000 3:11:51 PM

For corners in

Oceana

(County)

Located In:

Corner Code #

1. Public Land Survey

T16N R16W

H-9

T R

T R

T R

T R

2. Property Controlling  
in Section

S

T R

S

T R

3. Miscellaneous  
Property in Sec.

S

T R

S

T R

JOSEPH E. MERTEN  
REGISTER OF DEEDS

100991

Register of Deeds Stamp &amp; File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L
1												
2	6		5			4		3		2		1
3												
4	7		8			9		10		11		12
5												
6	18		17			16		15		14		13
7												
8	19		20			21		22		23		24
9												
10	30		29			28		27		26		25
11												
12	31		32			33		34		35		36
13												

I, J. Randolph Hepworth, in a field survey on June 19, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

## A. Description of original monument and accessories and/or subsequent restoration:

H-9 1/4 CORNER COMMON TO SECTIONS 22 &amp; 27 T16N, R16W

CRYSTAL TOWNSHIP

Oceana County Remonumentation  
Peer Group Reviewed & ApprovedDate: 11-21-00J. Randolph Hepworth  
Oceana County Surveyor

GLO J. Hodgson 1838 SET POST 6" Beech N56°W 19 lks 8" Beech S32°E 53 lks  
Book A, Pg. 268, H. A. Grant, 1887; Sec 22, T16N, R16W "Found stone previously set for Gov't 1/4 post."  
Book A, Pg. 242, Edgar M. Hyde, 1889; Sec. 27, T16N, R16W "Found stone corner and post took bearings."  
1) 24" R. Oak Stump S16.5°W 52lks 2) 20" Pine Stump N31°E 29lks  
Book C, Pg. 41A, E.M. Hyde, 1899; Sec 27, T16N, R16W Same description as Bk. A, Pg. 242.  
Book B, Pg. 46, F. Wetmore, 1903; Sec 27, T16N, R16W Corner not described.  
Book C, Pg. 42, F. Wetmore, 1903; Sec 27, T16N, R16W Corner not described.

Consumers Power Co., S-F17051, Blass Surveys, 1968, Found Iron

3) Blaze, Nail & Cap in 12" Sassafras S10°E 57.29'  
5) Blaze, Nail & Cap in 12" Oak N07°E 29.91'

4) Blaze, Nail &amp; Cap in 6" Sassafras S42°E 63.45'

Recorded Survey, Jkt# 453, Mitchell Surveys, Inc., #19618, 9/12/91 Fd 5/8" Rebar

6) 6" Poplar SSE 45.72' 7) 6" Poplar SSW 41.58'

8) Steel Sign Post WNW 94.27'

## B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

I found a 1/2"x16" Rebar Iron in the centerline of E-W Road and on old occupation to the south. No occupation is visible to the north. Witness #3, 4, 6 and 7 are standing and measure OK; all others above are missing. Upon excavation and removal, I found no other evidence of the corner. This corner falls in road cut of about 6' - 10' so any ancient corner evidence is now gone.


I accept the 1/2" Iron as the best available evidence of the position of the original corner. No evidence is known to me that would lead me to believe the corner should be at another location.

## C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 4"x20" Harrison Cast Iron Monument, stamped "County Surveyor" and "26457" above the 1/2" Iron which was driven down

3) set 60d spk	W Face	8" Sassafras	174°az	67.47'	EDM
6) set 60d spk over ex. Small nail	E Face	10" Poplar	153°az	45.52'	EDM
7) set 60d spk over ex. Small nail	E Face	8" Poplar	204°az	41.42'	EDM
set 60d spk	S Face	Power Pole	276°az	282.43'	EDM
set 60d spk	W Face	5" Oak	343°az	56.48'	EDM
set 60d spk	NE Face	6" Sassafras	113°az	67.51'	EDM

Signed by

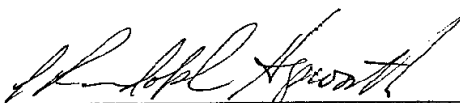

Date

December 15, 2000

Surveyor's Michigan License No. 26457

