

DEC 16 1998

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

SECTION
REGISTER'S OFFICE, SS

For corners in

Keweenaw
(County)

Located In:

Corner Code ##

1. Public Land Survey

T 57 R 33

T 57 R 33

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

4. Lot No. , Recorded Plat

5. Private Claims

I, John I. Haataja, in a field survey on 11/30, 19 98

do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

MC10 Meander corner between Section 32&33
T57N-R33W. Wood post set for meander
corner in 1846 by Samuel Hill.
9" Spruce S07°W 18 lks
12" Spruce S27°E 15 lks.

MC11 Meander corner between Section 32, T57N-R33
and Section 5, T56N-R33W. 10" Spruce used for
meander corner in 1846 by Samuel Hill.
8" Cedar N80°E 26 lks.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

MC10 found 1½" iron pin in concrete
set by Holland in 1917.

MC11 No evidence of original or other corner
found. Set meander corner S89°-53'-54"W
of section corner 32/33, and on intermediate
traverse line of Calumet Lakeshore Plat of
Survey.

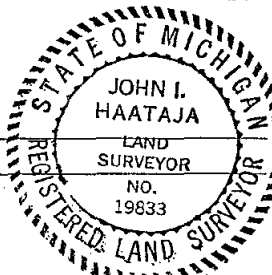
C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

MC10 Established a witness corner
24.67 feet South of meander corner
by placing a 1" iron pipe with a 4"
brass cap stamped Keweenaw County
Remonumentation Point.
1½" iron pin in concrete North 24.67'
4" Maple N52°E 6.55'
5" Cedar S33°E 5.30'
8" Cedar S48°W 31.35'

MC11 Established meander corner by placing a
1" iron pipe with a 4" brass cap stamped
Keweenaw County Remonumentation Point.

4" Cedar S39°E 8.65'
16" W. Birch N39°E 5.82'
5" Cedar N82°W 9.99'
14" W. Birch S37°W 27.81'

Signed by

Surveyor's Michigan License No. 19833Date 12/2/98

Rate See Group
In accordance with P.A. 345
Co. Rep. Samuel Hill
Date 12/3/98