

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

31132

For corners in

Oakland
(County)

Pontiac
Located in: Twp. Corner Code #

LIBER 21052 PAGE 184
\$7.00 MISC RECORDING
\$2.00 REMONUMENTATION
02/01/2000 09:59:20 A.M. RECEIPT# 7944
PAID RECORDED - OAKLAND COUNTY
G. WILLIAM CADDELL, CLERK/REGISTER OF DEEDS

1. Public Land Survey

T	3NR	10E	M-7
T	R		
T	R		
T	R		
S	T	R	
S	T	R	
S	T	R	
S	T	R	

2. Property Controlling in Section

3. Miscellaneous Property in Sec.

4. Lot No. _____ Recorded Plat _____
5. Private Claims _____

Raymond J. McCoy


Sept. 23 99

I, _____, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1817 Post GLO
There are no LCRC's recorded for this corner.

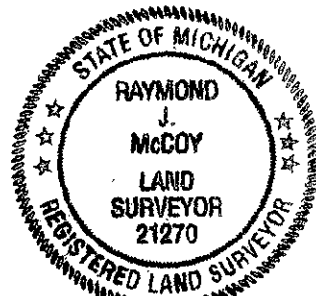

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
No corner was found. Corner was established by using monumentation found from various parcel splits in the SE 1/4 of Section 13. The corner was re-established by measuring from the found irons back to the corner position using existing legal descriptions.

State Plane Coordinates N 426646.6472
E 13434073.4222

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
Set a concrete monument consisting of a 1/2" iron rod encased in a 4" diameter concrete cylinder 36" long with a 2" diameter brass disk stamped Oakland County Remonumentation P.S. #21270.

Witnesses:

N 80° E, 32.87' Set OCRT in N. face of 8" Elm

S 50° E, 25.80' Set OCRT in NE face of 10" Elm

South, 25.89' Set OCRT in E. face of 7" Elm

N 80° W, 13.61' in N. face of 16" Willow

THE SELECTED LOCATION IS ACCEPTED BY ME AND IS GENERALLY ACCEPTED BY PROFESSIONAL SURVEYORS AS THE BEST AVAILABLE EVIDENCE OF THE POSITION OF THE ORIGINAL CORNER

Signed by

Raymond J. McCoy
Surveyor's Michigan License No. 21270

Date

1-05-00