LAND CORNER RECORDATION CERTIFICATE Ontonagon County Filing Requirement of Act 74, Mich. P.A:4970 of 1

JJT Date 08/14/2000 RECORDING FEE:

LC 5/326 Time 09:57!58 9,00

For corners in

Located in:


Corner Code #

Ontonagon County T52N R39W L - 7 1. Public Land Survey T R R Ţ R Т R T S 2. Property Controlling Ť R S in Section R S T Miscellaneous

**SURVEY &** REMONUMENTATION

MAR 02 2001

SECTION Register of Deeds Stamp & File Number

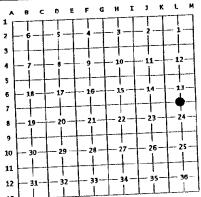

, Recorded Plat 4. Lot No. 5. Private Claims

Property in Sec.

I, Joseph C. Domitrovich, in a field survey on July 6, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a factor of a Court of I aw and for that the corner points martioned in lines 3. A and 5 above were in decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 comers, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(L - 7) 1/2 Corner Common to Sections 13 & 24, T52N, R39W.

1845 - William A. Burt set a Hemlock post with ties:

10" Sugar

N 27°E

27 links

6" Hemlock

N 55°W

23 links

I found no record of subsequent restoration.

B. Description of comer evidence found and/or method applied in restoring or reestablishing comer:

I found no remains of the original corner. There is a 3" diameter driveshaft with a ring welded to it that the local landowners have used to mark lines for logging. It falls 204' West of a single prorated position. I did not accept the drive shaft and restored corner position by single proportionate measurement. This position works well with GLO distances to Section Corners to the East and West, and with stream call to the West. There drong Presoned

Research on file with County Remonumentation Representative.

7-26-00 applekano  $\omega$ BUP FREMANATION

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 2 ½" x 30" aluminum pipe with a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION; T52N, R39W; S. 13, S. 24; ½; 2000; P.S. 37273. Corner falls 20' +/- North of a wandering East-West fence and 70' +/- South of an East-West logging road. Ties:

7.95 S 45°W 6" Hard Maple 10.71 N 40°W 8" Hard Maple 8.64 N 72°E 6" Hard Maple 12.91 S 54°E 1.00' (to face) 12" Hemlock South Steel Sign Rail 2622.59' S 89°45'49"W SW Cor. Sec. 13 2622.59 N 89°45'49"E SE Cor. Sec. 13

OF BICH JOSEPH DOMITROVICH LAND SURVEYOR Mo. 87273 PEANO STATE OF THE PARTY.

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

7/26/00

Surveyor's Michigan License No. 37273

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971 REVISED MAY 14, 1975 REVISED JOH., 1993 REVISED OCT., 1995

30,44 6