

JAN 19 2001

2000 REMONUMENTATION

Re. Mon Liber 2, Page 82

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

STATE OF MICHIGAN
HURON COUNTY
RECORDED

20 SEP 2000 2:07 PM

FRANCES L. HOLZWICK
REGISTER OF DEEDS

Huron Located in: Corner Code #
(County)

1. Public Land Survey Sherman T15N R16E A-9
T R
T R
T R
T R

2. Property Controlling S T R
in Section S T R

3. Miscellaneous S T R
Property in Sec. S T R

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

I, Charles S. Getz, in a field survey on May 10, 2000 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												


A. Description of original monument and accessories and/or subsequent restoration:
A-9 1834 G.L.O., H. Parke D.S. County Road Commission Records - Iron Pin in 6" Cedar Post
Set Post
Pine 15", S46°W, 29 1/2 Links Recorded Surveys - NONE
Hemlock 12", N65°W, 24 Links
Unrecorded Surveys - Millettics, 6-4-93, PK Nail
Millettics, 5-22-96, PK Nail
L.C.R.C. - NONE

County Surveyor Records -
NONE

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
A-9
SW Cor, Section 19, T15N-R16E
Found 3/4" Bar in Monument Box, 1' South of Road Centerline
Accepted as the best available evidence
of the original corner position
(Intersection of Atwater Road & Edwards Road)

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-9
SW Cor, Section 19, T15N-R16E
Found 3/4" Bar in Monument Box, 1' South of Road Centerline
N50°W 70.90' to Nail in Power Pole
N30°W 41.45' to Stop Sign
S45°W 54.70' to Nail in Telephone Post
S45°E 41.55' to Stop Sign
South 2642.04' to W 1/4 Cor, Sec 30, T15N-R16E
North 2638.45' to W 1/4 Cor, Sec 19, T15N-R16E

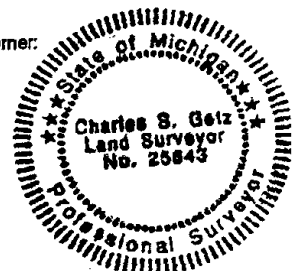

Signed by Charles S. Getz
Surveyor's Michigan License No. 25843

Date June 3, 2000

PEER GROUP APPROVED AT MEETING
HELD September 18, 2000. RLB