SURVEY & ANUMENTA" ON

MAR 02 2001

LECTION

9.00

LAND CORNER RECORDATION CERTIFICATE of 1 Ontonagon County

Filing Requirement of Act 74, Mich. P.A.JEA709te 09/06/2000 RECORDING FEE:

LC 5/334 Time 09:49:36

For comers in

Ontonagon County

Located in:

Corner Code #

1. Public Land Survey

T52N R39W T52N **R3BW** т R T R

2. Property Controlling in Section

3. Miscellaneous Property in Sec.


R S T S Ţ R S R

, Recorded Plat 4. Lot No.

5. Private Claims

 Joseph C. Domitrovich, in a field survey on August 21, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

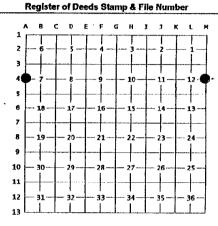

A. Description of original monument and accessories and/or subsequent restoration:

(M - 4/A - 4) 1/4 Corner Common to Section 12, T52N, R39W, & Section 7, T52N, R38W,

1845 - William A. Burt set a Hemlock ¼ post (Corner fell 0.25 chains south of a 15 link wide stream running NW)

12" B. Ash N 87°E 46 links

12" Y. Birch

S 57°W

31 links

1951 - Ned Hawley, Timber cruiser, noted in his copy of the original notes that he found a cedar stake "Huzzy" [Probably indicating it had been set by Henry Huzzy, another cruiser who did work in this area.] and that it was 10' N. to creek. Hawley also noted that the original Yellow Birch B.T. was still here, now a 12' stub.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner;

I found no remains of the original corner or bearing trees. I found a ¾" iron pipe at the GLO distance South of the old streambed. The pipe was probably placed by Ned Hawley as were numerous others in this township. Distances from the pipe to section corners north and south work very well. I have accepted the iron pipe as best remaining evidence of the original corner and placed a County Monument over it.

Research on file with County Remonumentation Representative.

COLUMN C. Description of monument for corner and accessories established to perpetuate locating the position of the corner;

Corner is a 2 1/2" x 30" aluminum pipe with a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION, T52N, R36W, R39W, S. 12, S. 7; ¼; 2000; P.S. 37273. Comer falls in an active beaver dam. Ties:

35,56

16" Hemlock S 18°W 30.67 (Existing Beaver Blaze) 14" Hard Maple S 47°W 41.78 Sign Rail North 0.25'(to face)

S 11°F location poster dated 1971, Reynolds/Pantti) NE Cor. Sec. 12 N OOORIAAIE 2642.19

S 00°00'13"W SE Cor. Sec. 12 2646.98'

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL

Surveyor's Michigan License No. 37273

20" Hemlock

(Existing Beaver blaze & Aluminum

OSEPH DOMITROVICH LAND SURVEYOR 37273

ORS JAC 2