

SURVEY & REMONUMENTATION

FEB 27 1998

SECTION

OTTAWA COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Ottawa

(County)

Located In:

Corner Code #

1. Public Land Survey

T5N R15W

G-11, NE cor. Sec.
33, Holland Twp.

T R

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

4. Lot No. , Recorded Plat

5. Private Claims

RECORDED

97 DEC -8 AM 11:30

Harry Schilt
REGISTER OF DEEDS
OTTAWA COUNTY, MI

Register of Deeds Stamp & File Number

I, STEVE LAMPEN, in a field survey on November 18, 1997, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. Brookfield 1832

80.00 set a post corner to Sections 27, 28, 36 and 34

W Ash 30 S81W 36

Beech 20 N76E 12

G-11 is shown on plats of Waverly Heights, 1928
Sweetman-Jaarda Subdivision No. 1 1984

E-11

LCRC Liber 2 Page 29 -973- Clapp

LCRC Liber 2 Page 111 -Spicer- 1973

LCRC Liber 2 Page 537 -Verba 1974

8" Maple NW 60.64

12" Maple N32°W 60.62

Power Pole 35° 43.24

P. Pole SW 42.95

CP Pole S30°W 43.00

Power Pole 142° 41.46

Guy Pole SE 41.52

MBT Pole N30°E 43.65

Power Pole 217° 42.88

P. Pole NE 43.58

MBT Pole S40°E 41.36

Power Pole 330° 59.98

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

G-11

Found 1/2" diameter iron in monument box at the centerline of 16th Street and Waverly. The location of this corner fits the monumentation of the plats: Listed in part A and all known surveys Replaced iron with Ottawa County Remonumentation iron and cap and is accepted as a careful and faithful perpetuation of the position of the original corner.

PA. 345 OTTAWA COUNTY

PEER APPROVED 12-1-97

Y.D.N.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

G-11

Ottawa County Remonumentation iron and cap in monument box.

A2 = Michigan State Plane grid direction

Hydrant top centerline

241° 31' 80.81'

Nail and remonumentation tag Northwest side power pole

341° 30' 77.88'

Nail and remonumentation tag Northwest side power pole

191° 38' 128.32'

"X" cut in steel base of steel pole


53° 37' 68.20'

Southwest corner building brick

203° 56' 181.96'

"X" cut in steel base of steel pole

216° 40' 62.44'

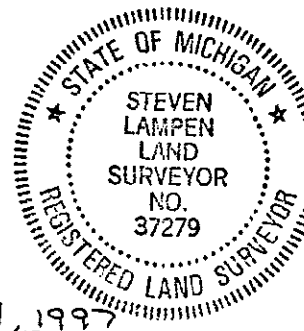

\$9.00 CORNER
\$1.00 PHOTO

Signed by Steven Lampen

Date DECEMBER 1, 1997

Surveyor's Michigan License No. 37279

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1976
REVISED JAN., 1983
ADAPTED FOR WORD PROCESSING MARCH, 1993