

JAN 22 2001

LIBER

3 PAGE 67

RECEIVED FOR RECORD

SECTION

2000 REMONUMENTATION PROGRAM  
LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

00 DEC -1 AM 9:33

BOOK NO. 3 PAGE NO. 67  
MICHELE VANHORMAN  
REGISTER OF DEEDS  
SARILAC CO. MICHIGAN

For corners in

Sanilac (County)	Located in:	Corner Code #
1. Public Land Survey	T12N R15E	G - 13
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

2000

I, John A Millettics, in a field survey on May 1, 1998 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:  
G - 13

SW Corner Section 34 T12N-R15E

GLO Notes

Black Ash 10" N69°E 6½ Links

Black Ash 12" N89°W 14½ Links

L.C.R.C. Forms - None

Act 132 - None

Unrecorded surveys - Kay Engineering Jan 1973 - Millettics Dec 1989-Millettics Dec 1997

Old Survey Liber - Thomas Nicol - Sept 1902

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


G - 13

SW Corner Section 34 T12N-R15E

Found 1" Iron Bar in Blacktop surface

East 2638.59 feet to the S 1/4 Corner Section 34

Accepted as best evidence

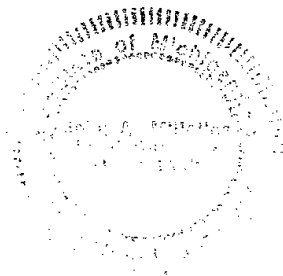

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

G - 13

SW Corner Section 13

1/2" Iron with cap set in concrete

West 5.84 feet to the NW Corner Section 3

South 29.35 feet to the present centerline M- 46

N80°W 18.75 feet to a stop sign

N30°W 87.62 feet to a nail in a Telephone Post

N30°E 86.77 feet to a nail in a Telephone Post

N45°E 55.30 feet to a nail in a Anchor Pole

S15°E 91.20 feet to a nail in a Power Pole - East 2638.59 feet to the S 1/4 Cor Sec 34

APPROVED PEER BOARD  
MEETING NOV 25 2000

*gm*

Signed by John A Millettics

Date Nov 15, 2000

Surveyor's Michigan License No. 25859