

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Oakland
(County)

Located In:

Corner Code #

\$ 7.00 MISCELLANEOUS RECORDING
\$ 2.00 REMONUMENTATION
23 FEB 98 11:13 A.M. RECEIPT# 1556
PAID RECORDED - OAKLAND COUNTY
LYNN D. ALLEN, CLERK/REGISTER OF DEEDS

Compliance with
ACT 345, P.A. 1990

APPROVED ON: 1-14-98 JS
OAKLAND COUNTY REMONUMENTATION
PEER GROUP COMMITTEE

Register of Deeds Stamp & File Number

- 1. Public Land Survey T 4N R 8E M-3
T _____ R _____
T _____ R _____
T _____ R _____
- 2. Property Controlling S _____ T _____ R RE SURVEY & RECONSTRUCTION
in Section S _____ T _____ R _____
- 3. Miscellaneous S _____ T _____ R _____
Property in Section S _____ T _____ R _____

4. Lot No. _____, Recorded Plat _____ SECTION _____
5. Private Claims _____

A	B	C	D	E	F	G	H	J	K
2	6	5	4	3	2				
3									
4	7	8	9	10	11				
5									
6	18	17	16	15	14				
7									
8	19	20	21	22	23				
9									
10	30	29	28	27	26				
11									
12	31	32	33	34	35				
13									

I, James J. Scharl, in a field survey on 11-17, 19 97, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

No record of G.L.O. corner being set in 1815 notes by Holmes for Township line. Corner referenced in 1817 notes by Carpenter 451 lks (297.66 ft) south of the NW corner of Section 7, T4N, R9E.

- LCRC, L 7947, P 870 Ward, 1980, fd monument
- *S 65°E 25.28' Spk 10" Oak
- S 05°E 28.73' Spk 20" Oak
- S 75°W 67.46' Spk 14" Oak
- N 05°W 83.38' Spk 12" Oak
- LCRC, L 12207, P 881 Ward, 1991, Fd monument
- *S 65°E 25.28 Spk 10" Oak
- S 05°E 28.73' Spk 20" Oak
- *N 45°E 29.89' Spk #22445, 8" Oak
- N 05°W 83.38' Spk 12" Oak

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Recovered concrete monument with O.C. remonumentation brass cap #22445 at intersection of Rattalee Lake Road centerline west and Ellis Road centerline to the north. Concrete monument and cap were confirmed as the NE corner of unrecorded "Waumegah lake Subdivision".

Witnesses Found

- *N 40°E 29.92' 8" Oak Tag #22445
- East 33.00' Rerod/cap #22445
- *S 30°E 25.26' 12" Oak Tag #22445
- %S 30°W 62.39' Concrete mon (62.41' calc)

*Confirms LCRC's %Confirms "Waumegah Lake Subdivision"


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Found concrete monument with O.C. remonumentation brass cap #22445.

- N 15°W 83.50' PK/remon tag #22445 E face 16" Oak
- N 45°E 29.94' PK/remon tag #22445 NW face 8" Oak
- S 30°E 25.28' PK/remon tag #22445 SW face 12" Oak
- South 28.73' PK/remon tag #22445 W face 22" Oak
- State Plane Coordinates
- N 465898.2116
- E 13369715.8810

The selected location is accepted by the Contractor and is generally accepted by professional surveyors as the best available evidence of the position of the original corner. This corner was also accepted by the Oakland County Peer Group as established under Act 345 of P.A. 1990.

Signed by James J. Scharl Date December 15, 1997
Surveyor's Michigan License No. 19843

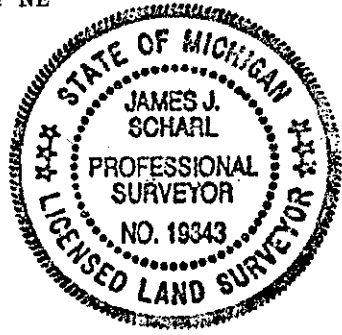

700 FILE
200