

SURVEY & REMONUMENTATION

APR 07 1998

Allegan County Remonumentation LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

Allegan (County)	Located in:	Corner Code #
1. Public Land Survey	T <u>4N</u> R <u>13W</u>	<u>J-1 (N¹, 2)</u>
	T _____ R _____	<u>Salem Twp.</u>
	T _____ R _____	
	T _____ R _____	
2. Property Controlling in Section	S _____ T _____ R _____	
	S _____ T _____ R _____	
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	
	S _____ T _____ R _____	

REGISTER OF DEEDS
ALLEGAN COUNTY, MICH.

98 JAN 21 PM 1:36

FILED

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, John C. Bueche, in a field survey on April 15, 19 97, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therofore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

J-1 GLO L890, P260, Aug., 1976	LCRC L3, P185, April, 1978
Not set CP Co.	Set T iron at gov't. prorate dist.
West from S 1/4 35, 5-13	of 2" iron found & accepted
2595.11' to NW 2	(on fence North) S 1/4 35, 5-13
East from S 1/4 35, 5-13	Nail in N side 20" Walnut S 75° E 94.90'
2630.30' to NE 2	Nail in S side 24" Catalpa N 60° E 63.45'
Show N 1/4 28.19'	Nail in E'ly side 24" Catalpa N 40°
E. of S 1/4 35, 5-13	E 36.72'
Nothing set	Iron W 21.78', C/L rd. N 3'±

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

J-1 Found T iron 0.14' South of the South line of Twp. to the North
No occupation South
Set point on South line of Twp. As per above wit.
to the North
Meas. West to NW 2 2618.01' (CP Co. 2623.23' they had 28.19' jog)
Meas. East to NE 2 2629.87' (CP Co. 2623.30')
This position not established by original government surveyors.
This monument is accepted as the best available evidence of the position of the corner.

Traverse J-13 to K-13 2651.65'
See sketch on back


Peer group approved May 13, 1997.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

J-1 Set Allegan Co. Mon. (3/4" x 24" pin with cap) on South line
of Twp. to the North (removed "T" iron)
Nail & Ottawa Co. Remon. Tag E side 10" Ash N 21° W 39.51'
Nail & Allegan Co. Remon. Tag NW side 36" Catalpa N 40° E 36.08'
Nail & Allegan Co. Remon. Tag S side 30" Catalpa N 72° E 82.81'
Nail & Ottawa Co. Remon. Tag in N side 22" Walnut S 75° E 94.29'
NW cor. barn fnd. S 24° W 131.55'
C/L gravel rd. E-W North 2'±, tree row North, West 22'±
Ottawa Co. Mon. S 1/4 35, 5-13 West 21.78'

Signed by John C. Bueche, P.S. 13027
Surveyor's Michigan License No. _____

Date 7-3-97

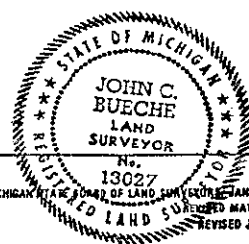

FORM APPROVED BY MICHIGAN BOARD OF LAND SURVEYORS JAN. 28, 1971
REVISED MAY 14, 1978
REVISED JAN., 1983

UNIT 0006 PAGE 219

Sheet 1 of 2

