

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Chippewa Co.

3 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>44</u> N. R. <u>6</u> W.	K-12, I-12, G-12
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. S. R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S. R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 2-6, 1981, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

All corners set by H. Brevoort Jr., D.S. in 1845. Bearings were:

- K-12 Quarter Corner bet. Sec's 35-36. Spruce 4, N20°E, 12 lks. & Spruce 6, S60°W, 19 lks.
- I-12 Quarter Corner bet. Sec's 34-35. Balsam 12, N33°E, 16 lks. & B. Ash, S37°E, 17 lks.
- G-12 Quarter Corner bet. Sec's 33-34. Tam. 6, S58°W, 07 lks. & Alder 3, S41°E, 12 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- K-12 Corner restored midway and on line bet. two section corners. No evidence of original cor.
- I-12 Corner restored midway and on line bet. two section corners. No evidence of original cor.
- G-12 Corner restored midway and on line bet. two section corners. No evidence of original cor.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed 1" pipe with 4" aluminium cap at all corners. New Bearings:

- K-12 6" Spruce, S15°W, 22.5' & 8" W. Pine, N22°E, 46.1'.
- I-12 16" W. Pine, S3°E, 40.7' & 6" Cedar, N30°E, 16.5' & 5" Cedar, S12°E, 33.9'.
- G-12 12" Cedar, S6°W, 20.4' & 8" Cedar, S42°W, 29.4' & 6" Cedar, N48°E, 25.3'.


SIGNED BY Billy D. Buckler DATE 2-11-81
 Billy D. Buckler

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

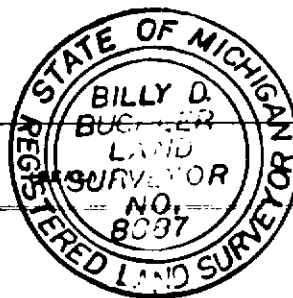

SURVEYOR'S MICHIGAN REGISTRATION NO. _____