

**SURVEY &  
REMONUMENTATION**

CHIPPEWA COUNTY REMONUMENTATION CORNER

APR 26 1995

**COMMISSION**

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in  
**Chippewa**

(County)

Located In:

Corner Code #

1. Public Land Survey T 45N R 1W H-7  
T \_\_\_\_\_ R \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_
2. Property Controlling S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
in Section S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_
3. Miscellaneous S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
Property in Sec. S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_
4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
5. Private Claims \_\_\_\_\_



\$ 7.00 LAND CORNER  
\$ 2.00 MSSR  
24 OCT 94 3:48 P.M. RECEIPT# 831  
RECEIVED FOR RECORD  
CHIPPEWA COUNTY - STATE OF MICHIGAN  
SHARON H. KENNEDY, REGISTER OF DEEDS

Register of Deeds Stamp & File Number

I, Keith R. Waters, in a field survey on February 21, 19 94,  
do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned  
in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the  
current manual of survey instructions of the United States Department of the Interior, Bureau of Land  
Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5  
above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a  
Court of Law; established, re-established, monumented, re-monumented, recovered, found as  
expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded  
on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

H-7 1/4 Corner Common to Sections 15 & 22, T45N, R1W

Original ties to post: Cedar 10, N35°W 10 links  
Cedar 8, S24°E 08 links

1959 - This corner is recorded in liber 3, page 27, Chippewa County corner  
records, by Billy Buckler, P.S. 8887, as a 1" pipe with 4" brass cap.

Record witnesses: 3" Cedar, N26°E 15 links 5" B. Ash, S12°W 6 links  
Corner is 2 chains south of old E-W railroad grade.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

H-7 (T45N, R1W)

This corner is being perpetuated as part of the Chippewa County  
Remonumentation Program.

Found a 1" iron pipe with 4" brass cap stamped "Michigan Department of  
Conservation - Forestry Division" in a swamp approximately 2 chains south of  
remains of old east-west railroad grade. Distance to remains of a blazed  
black ash checks well with previous recording. Buckler's corner form  
indicates that corner was set mid-way on line between Section corners. Corner  
falls approximately 125 feet north of south edge of swamp, and approximately  
300 feet east of west edge of swamp. Accepted corner as found and established  
four new witness objects.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

H-7 (T45N, R1W)

Corner is a 1" pipe with 4" brass cap in a swamp, approximately 132 feet south  
of an old east-west railroad grade. Witnesses:


9" Cedar, N38°W 76.20'  
11" Spruce, N12°E 146.75'  
6" Red Maple, S28°W 124.82'  
10" Spruce, S60°W 117.00'

Note: Distances are to a nail and tag in the  
side of the tree. Trees are blazed and  
painted. Bearings are compass bearings  
corrected for declination.

Signed by Keith R. Waters

Date 10-18-94

Surveyor's Michigan License No. 33142

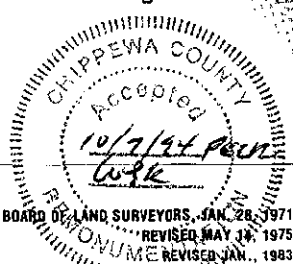

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1983