

1999

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

Chippewa County Remonumentation Corner

SECTION

For corners in

Chippewa County

Located In:

Corner Code #

1. Public Land Survey

T 46N R 2E

H/I-5

2. Property Controlling
in Section

S T R

3. Miscellaneous
Property in Sec.

S T R

4. Lot No. , Recorded Plat

5. Private Claims

I, Larry R. Rogers in a field survey on November 10, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

\$7.00 LAND CORNER

\$2.00 NSSR

21 JAN 1999 10:06:17 AM Receipt #1312

RECEIVED FOR RECORD

CHIPPewa COUNTY - STATE OF MICHIGAN
SHARON H. KENNEDY, REGISTER OF DEEDS

BOOK 10 PAGE 324

Register of Deeds Stamp & File Number

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

(H/I-5) Meander Corner between Sections 10 and 15, Township 46 North, Range 2 East.

The original corner was placed in 1845 by James H. Mullett. County Surveyor records make no specific reference to this corner.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(H/I-5) Meander Corner between Sections 10 and 15, Township 46 North, Range 2 East.

This corner is being perpetuated as part of the Chippewa County Remonumentation Program.

Found no evidence of original corner position or any subsequent restoration. Re-established corner position by extending a line from the Northwest Corner of Section 15 through the North 1/4 of Section 15 and setting a 3/4" x 48" rerod with stamped aluminum cap at record G.L.O. distance (191.4 feet) East of the 1/4 corner. Corner falls in tag alder swamp with only one acceptable witness so we set three capped iron pipes as witnesses.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(H/I-5) Meander Corner between Sections 10 and 15, Township 46 North, Range 2 East.

Corner is a 3/4" x 48" rerod with stamped aluminum cap set 4" above ground in tag alder swamp.

Witnesses:

8" Ash	N89°W	69.05 feet
Iron Pipe	S40°W	23.49 feet
Iron Pipe	S51°E	25.40 feet
Iron Pipe	N30°E	20.76 feet
Steel Fence Post	North	2.0 feet

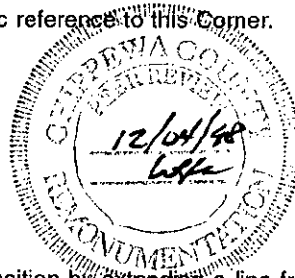

Signed by _____ Date 30 DEC 1998

Surveyor's Michigan License No. 29251

NOTE: All bearings are compass bearings corrected for declination (6°W). All distances are to a nail and tag in the side of witness object unless otherwise noted.

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971

REVISED MAY 14, 1975

REVISED JAN., 1983

REVISED OCT., 1995