FEB 23 2001

SECTION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

Chippewa County Remonumentation Corner 7.00 LAND CORNER

For corners in

Chippewa County Located in: Corner Code # Public Land Survey T47N R2E T R Τ R Т R 2. Property Controlling S Ţ R in Section S T R Miscellaneous S T R Property in Sec.

\$2.00 MSSR

9 FEB 2001 10:34:14 AM Receipt #1201 RECEIVED FOR RECORD CHIPPEWA COUNTY - STATE OF MICHIGAN

SHARON H. KENNEDY, REGISTER OF DEEDS

PAGE 236 воок 11


Register of Deeds Stamp & File Number

4. Lot No.

5. Private Claims

above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

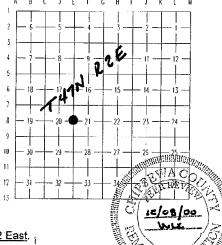

N19E 8 Cedar 8

- FH Brown, Chippewa County Surveyor shows North 1/2 Mile between 20 and 21 as measuring 2620 and South 1/2 Mile as measuring 2625. He notes corner as original and in place previously, but gone at this point.
- 1923 FH Brown, Chippewa County Surveyor shows North 1/2 Mile between 20 and 21 as measuring 2607.00 and the South 1/2 mile as measuring 2645.28 feet. He notes that an individual by the name of Clark had done work on the interior of Section 20 that was in error but was reluctant to make changes because of the length of time that lines had been in place.
- AH Colwell shows North 1/2 mile between 20 and 21 as measuring 2621.5 which is consistent with Brown's 1927 1906 survey.
- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner: (E-8) 1/4 Corner common to Sections 20 and 21, Township 47 North, Range 2 East. This corner is being perpetuated as part of the Chippewa County Remonumentation Program.

Found no evidence of original corner. Found a very old "T" iron 34.7 feet East of a North – South (right-of-way) fence and on line with a very old fence line to the East. Distance North to Section corner 16, 17, 20 and 21 is 2615.40, (Brown 2620) Distance South to Section corner 20, 21, 28 and 29 is 2616.21 (Brown 2625). Accepted corner position as found and remonumented.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner: (E-8) 1/4 Corner common to Sections 20 and 21, Township 47 North, Range 2 East.

Set a 3/4" x 24" iron with stamped aluminum Chippewa County Remonumentation Corner Cap flush with 35 feet more or less East of North - South fence and on fence line to the East.

Witnesses:

White Birch 6" N22°E 82.16 feet 3/4" Witness Pipe 40.91 feet S42°E Fence Post S75°W 37.43 feet Fence Post N68°W 36.81 feet

Bearings are magnetic compass bearings. All distances are to a nail and tag in the side of the witness object unless otherwise noted.

Signed by William L. Karr, P.S

Surveyor's Michigan License No. 27450

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971

1 PAGE 236 REVISED MAY 14, 1975
PAGE 236 REVISED OCT., 1995

KARR

LAND

No.

JRVEYOR

c:\word\nls\cornerforms\2000 chippewa\t47nr2e e-8 doc

, Recorded Plat

I, William L. Karr, P.S., in a field survey on December 08, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2

A. Description of original monument and accessories and/or subsequent restoration: (E-8) 1/4 Corner common to Sections 20 and 21, Township 47 North, Range 2 East. John Mullett, DS set Post Cedar 10 S69W 16