

SURVEY &
REMONUMENTATION

APR 27 1995

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

1994 NOV 14 AM 10:00

For corners in

Dickinson

(County)

Located In:

Corner Code #

1. Public Land Survey

T 39N R 29W

L-9

T R

T R

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

REGISTER OF DEEDS
DICKINSON COUNTY
RECORDED 11/14/94

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

1/4 cor. Sections 24 & 25

I, John R. Garske, in a field survey on September 12, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- October 22, 1849 - James H. Mullett, D.S., set quarter section post: Spruce pine 8" - S62°W, 24 links; spruce pine 8" - N15°E, 13 links.
- W.C. Johnson - Set bolt at 1/4 corner.
- 1974 R.F. Perkins found W.C. Johnson's bolt 70.25 feet south of fence corner.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found W.C. Johnson's 1" square bolt as shown on R.F. Perkins' 1974 plat of survey. Corner lies 70 feet ± south of fence corner and 2.25 feet east of a post and barbed wire fence.

Accepted as best available evidence for corner position.

ACCEPTED BY THE DICKINSON COUNTY
SURVEY PEER GROUP AS THE OFFICIAL
CORNER UNDER MICHIGAN PUBLIC ACT
345 OF 1990 AT A MEETING HELD ON

11-7-94

R.F.P.

COUNTY REPRESENTATIVE

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Replaced bolt with 1" x 36" aluminum rod with stamped Dickinson County aluminum cap. Drove bolt back in along west side of aluminum rod. Set carsonite witness post west of monument. Established the following references: found 1 1/4" solid pin at fence corner - N02°E, 69.71 feet; red pine 9" - N46°E, 34.21 feet; red pine 8" - East, 16.56 feet; red pine 8" - S34°E, 35.80 feet.

Signed by


John R. Garske

Date

9/27/94

Surveyor's Michigan License No.

28410

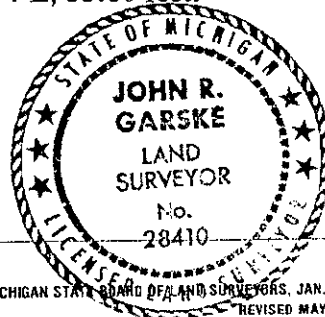

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1972
REVISED JAN., 1980

Liber 2 Page 110