

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

1998 DEC 14 PM 12: 24

For corners in

<u>Dickinson</u> (County)	Located in:	Corner Code #
<u>Breitung Twp.</u>	<u>T 40NR 31W</u>	<u>J-9</u>
1. Public Land Survey	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

REGISTER OF DEEDS
DICKINSON COUNTY
RON MORSE, CLERK

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Robert F. Perkins, in a field survey on Oct 8, 1998 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:


J-9 $\frac{1}{4}$ Corner Common to Sections ²³/₂₆
Post by James H. Mullett, D.S. 1849
40.06 Set Post
Original Bearing Trees
W. Pine 4" N65°E 32 Lk.
Aspen 4" N77°W 33 Lk.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

J-9 No Evidence of Original Corner or Accessories Found.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

J-9 Set 2" Stamped Aluminum Cap at Mid-Point on Line between Section Corner $\frac{1}{2}$ Mile East and $\frac{1}{2}$ Mile West.
New Witnesses
Maple 7" N70°E(M.B.) 26.95' Nail/Tag
Aspen 7" N21°W(M.B.) 31.37' Nail/Tag
Cherry 3" S06°W(M.B.) 58.83' Nail/Tag
J.Pine 3" S30°E(M.B.) 67.49' Nail/Tag
Placed Carsonite Marker 2.85' North

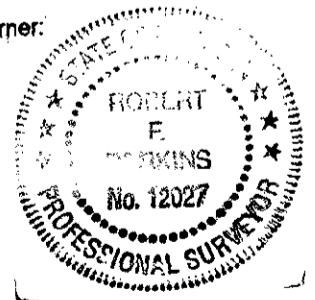

Signed by Robert F. Perkins
Surveyor's Michigan License No. 12027

Date Oct. 24, 1998

REGISTERED PROFESSIONAL SURVEYORS OF MICHIGAN COUNTY REPRESENTATIVE GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD ON
12-7-98
Robert F. Perkins
COUNTY REPRESENTATIVE

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1985

Liber 2 Page 399