

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

or corners in

Form containing Dickinson (County), Located In, Corner Code #, and various survey details like Public Land Survey, Property Controlling, and Miscellaneous Property in Sec.

Form for Lot No., Recorded Plat, and Private Claims.

Text block containing survey dates (6/12/2014, 6/11/2014) and a statement of compliance with Michigan P.A. of 1970.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded in this certificate.

Description of original monument and accessories and/or subsequent restoration:

B07) Quarter corner common to Sections 18 and 19. 1848: Harvey Mellen, DS. Set Ironwood quarter section corner post witnessed by Sugar 20 N72W 22 links (14.52'), Sugar 10 S62E 16 links (10.56').

B09) Quarter corner common to Sections 19 and 30. 1848: Harvey Mellen, DS. Set Yellow Birch quarter section corner post witnessed by Ironwood 9 S42E 12 links (7.92'), Ironwood 6 N44W 21 links (13.86').

Description of corner evidence found and/or method applied in restoring or reestablishing corner:

B07) Accepted found MDNR Monument and Two NBT Witness (SE NBT living, NE NBT dead and down). Position is accepted as a careful and faithful REESTABLISHMENT of the position of the original corner.


B09) No evidence of original survey. Corner position reestablished by single proportionate measurement between the Southeast corner and the Southwest corner of Section 19.

Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Table with 4 columns: Monument, DNR monument, (B09), and DNR monument. It lists various trees and measurements for B07 and B09.

Surveyor's Michigan License No. 50447

For the Michigan Department of Natural Resources, Forest Resources Division

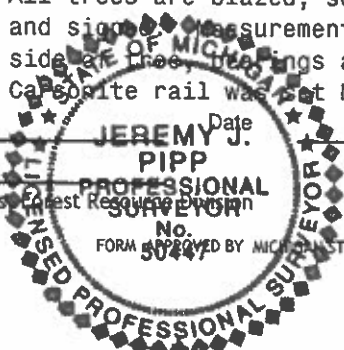

Register of Deeds Stamp & File Number table with columns A-M and rows 1-13.