mrit. 0 - 2000	
SECTION	Ĺ
For corners in Gogebic	Located in:
(County)	Section 29
1. Public Land Survey	T
2. Property Controlling in Section	S T S T
3. Miscellaneous Property in Sec.	\$

AND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

Gegebic	s vilice County			
	Received	lor	1000	A.G
21	<u> </u>	y of.	Ju	<u>. r</u> _
A D. 1	999 a	1:	05	e'ci
	n_	and	(1800)	nded
E 44	7	- 4	CA	# 418
an nege	168		,	
ame	na Pell	IMA	Ou) (-

Corner Code # 44N 39W C-D-9


Register of Deeds Stamp & File Number

4. Lot No	, Recorded Plat
5. Private Claims	

EAST Meander corner common to section 20, 29, T44N, R39W

John R. Garskein a field survey of anuary 5, , 19<mark>99</mark> do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

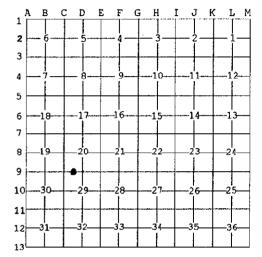

Description of original monument and accessories and/or subsequent restoration:
Original survey by Wells Burt, D.S. in 1851.
Original Bearing Trees: 16" yellow pine N15°E
12" white pine N63°E

N15°E

29 links (19.14 feet)

N63°E

50 links (33.00 feet)

1988-Gary L. Pisoni, RLS #27457 found and replaced 3/4" iron pin set by unknown persons; with a 2" x 30# aluminum pipe monument with a 3" cast aluminum cap stamped to identify the 8' balsam N44°E 31.62 corner from which he established:

8" balsam

N72°E

S72°E

29.74 5.41'

2" tamarack

30

\$50°E 1.17' 61 steel sign post

(corner recorded liber 3, page 140)

Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found the monument and accessories as described above, all in good condition. I set nails in all the trees and recorded new ties as noted below with new B.T.'s established.

(Research on file)

COUNTE

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Monument found as described above from which I established the following witnesses:

Steel sign post

S55°E

1.16 feet (existing) (1.17')

N22°E N73°E 16" balsam 12" balsam

34.20 feet (existing) (31.62') 29.02 feet (existing) (28.74')

10" tamarack

S72°E

5.59 feet (existing) (5.41')

JOHN R. garske LAND SURVEYOR

Surveyor's Michigan License No.

CHAS