

Re-Mon Liber 2, Page 97

2000 REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN
HURON COUNTY
RECORDED

29 NOV 2000 11:22 AM

FRANCES L. HOLDWICK
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

For Corners in

Huron
(County)

Located in:

Corner Code #

1. Public Land survey: Brookfield T 15_N_ R 10_E

T ___ R ___
T ___ R ___
T ___ R ___

A-9 ✓
A-10

2. Property Controlling
in Section

S ___ T ___ R ___
S ___ T ___ R ___

3. Miscellaneous
Property in Sec.

S ___ T ___ R ___
S ___ T ___ R ___

SURVEY &
REMONUMENTATION
JAN 19 2001

4. Lot No. _____, Recorded Plat _____

SECTION _____

5. Private Claims _____

I, James T. Meek, in a field survey on October 1, 2000,

do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules thereof as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L
2	8	5		4	3	2						1
3												
4	7	6	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
Original survey, West Bdy. T15NR10E, 1835,
Harvey Parke D.S.

A-9 Corner of Sections 19, 30
Post
Cedar 16", N29°W, 41 links
Hemlock 8", S16°W, 15 links
County Surveyor's Record: ¾" iron pin
Recorded Surveys: L3, P389 (Brown); L3,
P690, P691 (Brown)
LCRC: none

A-10 West ¼ Corner of Section 30
Post
B. Ash 16", N39°W, 7 links
B. Ash 16", S55°W, 33 links

County Surveyor's Record: ¾" iron pin
Recorded Surveys: none
LCRC: none

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

A-9 Corner of Sections 19, 30

Found 1" iron in mon box
At intersection of Bay Port & McAlpin
Roads

Accepted as the best available evidence
of the original corner position.

A-10 West ¼ Corner of Section 30

Found no evidence of the original corner
position

Set ½" iron w/cap #39089 in mon box
At proportionate distance
Occupation lines bear East & West

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-9 Corner of Sections 19, 30
1" iron in mon box
From which:
Road sign post bears N60°E, 40.5'
Wood post bears S55°W, 46.6'
Road sign post bears S60°W, 33.0'
Tag in power pole bears N60°W, 36.1'
A-10, ¼ Corner of Section 30 bears
S0°19'59"E, 2631.60'
A-8, ¼ Corner of Section 19 bears
N0°02'59"E, 2632.40'


A-10 West ¼ Corner of Section 30
½" iron w/cap #39089 in mon box
From which:
½" iron bears N45°E, 25.0'
½" iron bears S45°E, 25.0'
Tag in power pole bears S45°W, 56.05'
Metal post bears S85°W, 38.25'
A-11, Corner of Sections 30, 31 bears
S0°19'59"E, 2631.60'
A-9, Corner of Sections 19, 30 bears
N0°19'59"W, 2631.60'

Signed by [Signature]

Date 2, 2000

Surveyor's Michigan License No. 39089

APPROVED AT PEER BOARD MEETING 11-02-00 RLB

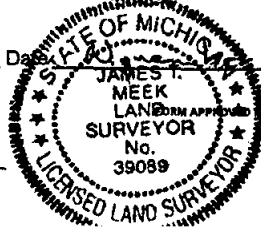

MICHIGAN BOARD OF LAND SURVEYORS, JAN 28, 197
REVISED MAY 14, 1971
REVISED JAN, 198
REVISED OCT., 1991