LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

Iron (County)

		Located In:		Corner Code #
1. Public Land Survey		T 42N	R 35W	L4
		T	R	
		T	R	
	S	T	R	
2. Property Controlling	S 12	T 42N	R 35W	5
in Section	S	T	R	
3. Miscellaneous	S	T	R	
Property in Sec.	S	T	R	

Register of Deeds Stamp & File Number

4. Lot No. _____ , Recorded Plat_____

5. Private Claims

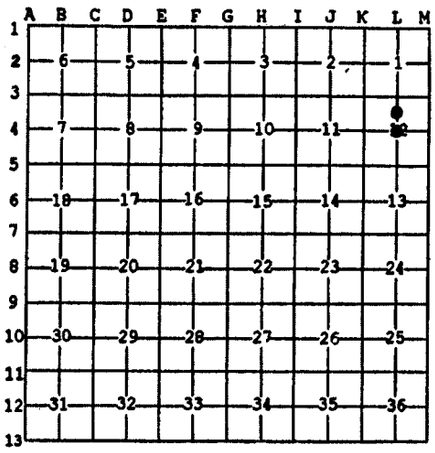

Jun 20 2006

I, Stephan J. Szyszkoski, in a field survey on _____, 20 ____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(L4) Center of Section 12. Not established in the original survey.
(5-Sec. 12) North 1/16 corner, Section 12. Not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(L4) Established the corner at the intersection of straight lines connecting opposite Quarter corners. Quarter corner L3 was recently reestablished by Gary L. Pisoni, PS 27457 and is marked by a Witness Corner, a 1/2" rebar, 36.00' east of L3.
(5-Sec. 12) Established the corner midway and on a straight line between Quarter corner L3 1316.50' north and Center of Section 1316.50' south. Corner L3 was recently reestablished by Gary L. Pisoni PS27457 and is marked by a Witness Corner, a 1/2" rebar, 36.00' east of L3.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(L4) Set 1"IDx32" I.pipe with 4" alum. MDNR cap. Set measuring nails in:
4" Cedar N43E 11.5 mrkd "C1/4 BT"
5" Cedar S41W 2.35' do
6" Cedar N59W 13.4' do
4" Cedar N08W 11.0' do
Set sq'd cedar post adjacent. Bearings are magnetic. Distances are to nail with tag.

(5) Set 1"IDx32" I.pipe with 4" alum. MDNR cap. Set measuring nails in:
6" Poplar N74E 140.4' mrkd "1/16S BT"
11" Poplar S50W 41.4' do
5" Poplar N65W 29.8' do
6" Poplar N53W 45.4' do
Set sq'd cedar post adjacent. Bearings are magnetic. Distances are to nail with tag.

STATE OF MICHIGAN
STEPHAN J. SZYSZKOSKI
LAND SURVEYOR
No. 33986
LICENSED LAND SURVEYOR

Signed by Stephan J. Szyszkoski Date 7/6/06

Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources, Office of Land and Facilities

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
Revised May 14, 1975
Revised Jan., 1983
Revised Oct., 1995