

# SURVEY & REMONUMENTATION

FEB 21 2001

## SECTION

### LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Iron</u> (County)	Located in:	Corner Code #
1. Public Land Survey	T <u>43N</u> R <u>31W</u>	<u>C-12</u>
	T <u>    </u> R <u>    </u>	<u>    </u>
	T <u>    </u> R <u>    </u>	<u>    </u>
	T <u>    </u> R <u>    </u>	<u>    </u>
2. Property Controlling in Section	S <u>    </u> T <u>    </u> R <u>    </u>	<u>    </u>
	S <u>    </u> T <u>    </u> R <u>    </u>	<u>    </u>
3. Miscellaneous Property in Sec.	S <u>    </u> T <u>    </u> R <u>    </u>	<u>    </u>
	S <u>    </u> T <u>    </u> R <u>    </u>	<u>    </u>

COMMENCED YEAR 2000  
RECEIVED FOR RECORD  
IRON COUNTY, MICHIGAN

00 DEC 22 PM 3:25

L.C. Records: 1.8, P. 307

*Robert L. Pisoni*  
REGISTERED LAND SURVEYOR

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

Quarter Corner Between Sections 31 and 32, T43N, R31W

I, Gary L. Pisoni, in a field survey on November 28, 2000 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

#### A. Description of original monument and accessories and/or subsequent restoration:

Original corner established on July 16, 1849 by John Burt, U.S. Deputy Surveyor.

Original Corner: Wood Post

Original Bearing Trees:

White Pine	18"	S 36° E	35 links (23.10 feet)
White Pine	20"	N 46° W	28 links (18.48 feet)

#### B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No evidence of original B.T.s found.

Found a WI/MI Power Company concrete monument with a brass cap marking corner position, 6" above ground surface and stamped as follows: T43N, R31W, 1/4, S-31, S-32

I accept the concrete monument as the best available evidence for restoring the corner position.

Found an existing bearing tree set by unknown person.

White Birch	12"	S 88° W	16.84 feet
-------------	-----	---------	------------

Corner record research on file with County Representative.

#### C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Blazed and scribed the following new bearing trees: (all measurements taken to a nail in side of tree)


White Spruce	13"	S 14° E	35.69 feet
Black Cherry	6"	N 18° W	59.22 feet
Balsam	8"	N 40° E	12.28 feet
Steel sign post		S 15° W	1.0 feet

00-075

Signed by Gary L. Pisoni Date 12-19-2000

Surveyor's Michigan License No. 27457

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971

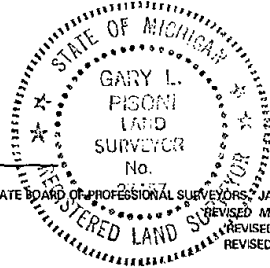

LIBER

8 PAGE 307