

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

KALKASKA _____

(County)

Located In:

Corner Code #

2000 REMONUMENTATION

1. Public Land Survey

T 27N R 6W

C-2

T _____ R _____

T _____ R _____

T _____ R _____

T _____ R _____

2. Property Controlling

S _____

T _____ R _____

in Section

S _____

T _____ R _____

3. Miscellaneous

S _____

T _____ R _____

Property in Sec.

S _____

T _____ R _____

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, EUGENE FARRIER, in a field survey on August 22, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

C-2: 1/4 Cor. Common to Secs. 5 & 6, T27N-R6W, Excelsior Township

1852: GLO resurvey by George H. Cannon; set post for corner; Beech 8", S 40°W, 8 links; Beech 14", N 62°E, 25 links.

1879: Survey by J. Nelson in Liber 1 Pages 500-502; found 2" well point at corner; in centerline Hagni road and in line of old fence row to West; nail and tag South side 28" Maple, Az 78° (N 78°E), 56.00'; nail in tag in West side 8" Maple, Az 163° (S 17°E), 79.69'; nail and tag in East side 24" Maple, Az 206° (S 26°W), 71.46'; nail and tag in North side 14" Maple, Az 282° (N 78°W), 32.04'.

1980: LCRC by H.L. Fluharty in Liber 2 Page 256; found 2" pipe at corner; about the same as 1979 survey above.

1984: LCRC by B.M. Jones in Liber 2 Page 337 and surveys (not recorded) by B.M. Jones; found 1/2" pipe at corner; metal fence post, West 33.65'; 36" Maple, N 70°E, 55.85'; 12" Maple, N 20°W, 77.93'; 1/2" iron East 33.00'.

1985-1991: Surveys (not recorded) by N.B. DeYoung; found 1 1/2" pipe at corner; 24" Maple, S 30°W, 71.00'; 18" Maple, N 80°W, 31.10'; 8" Maple, S 30°E, 79.30'; 1/2" rod East 36.00'.

1991: Survey by B.M. Jones in Liber 4 Page 22; tied corner only

2000: Survey (not recorded) by D.R. Farrier; found 1 1/2" pipe at corner, same as 1985 survey above.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

C-2: 1/4 Cor. Common to Secs. 5 & 6, T27N-R6W, Excelsior Township

Found 1 1/2" well point at corner in centerline road, on old fence line E-W; found iron and cap (B. Jones) East 33.00'. Added 5/8" rerod with standard County monument.

No G.L.O. witnesses were found.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-2: 1/4 Cor. Common to Secs. 5 & 6, T27N-R6W, Excelsior Township

Found 1 1/2" well point at corner in centerline road, on old fence line E-W; found iron and cap (B. Jones) East 33.00'. Added 5/8" rerod with standard County monument.

N 40°W, 36.55', 12" Maple, set nail and tag

East 33.00', found iron and cap (B. Jones)

S 43°E, 32.90', 6" Ash, set nail and tag

S 60°W, 30.09', 5" Elm, set nail and tag

Relined by Peer Group
P.A. 345 - 1990 Kalkaska County


Chairman Eugene Farrier

Date 8-14-01

Kalkaska County Peer Group accepted the above monument as the best available evidence of the position of the original corner.

Signed by Eugene Farrier
Surveyor's Michigan License No. 24594

Date 8-15-01

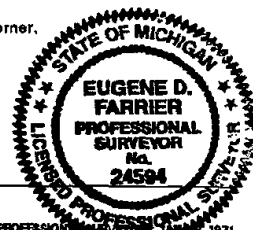

3026820

Page: 1 of 1
82/18/2001 10:26A
REMON
LB: 6 PG: 149

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, 1971
REvised JULY 14, 1976
REvised JAN. 1983
REvised OCT., 1985