

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

KALKASKA
 (County)

Located In:

Corner Code #

2000 REMONUMENTATION

1. Public Land Survey

T 27N R 6W

D-1

T 28N R 6W

D-13 ✓

T R

T R

2. Property Controlling
 in Section

S T R

S T R

3. Miscellaneous
 Property in Sec.

S T R

S T R

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, EUGENE FARRIER, in a field survey on August 23, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

D-1: 1/4 Cor. Common to Sec. 5, T27N-R6W, Excelsior Township; D-13: Sec. 32, T28N-R6W, Coldsprings Twp, Kalkaska Co.

1839, G.L.O. Resurvey, by J.H. Mullett, set post for corner; Beech 8", N61°W, 39 Lks; Beech 7", N35°E, 31 Lks

1978, DNR Drawing, by C.F. Roser, showing Section line thru corner

1984, LCRC & Survey, by B. Jones, Liber 2, Pg 337, found 1/2" iron & cap #24594; 12" Scotch Pine, N28°E, 72.40'; 10" Maple, S17°E, 75.00'; power pole, S65°E, 81.05'; 14" Maple, N80°W, 127.45'

1985, Survey, by E. Farrier (Co. Surveyor) set 3/4" iron pipe & cap by spm, in centerline of E-W road, 3' West of trail road to North; 11" S. Pine, N50°E, 72.39', power pole, S64°E, 81.07'; 11" Maple, S25°E, 74.98'

1991, Survey, by N.DeYoung, found 1/2" rod; power pole, S70°E, 80.9'; 12" R. Pine, N50°E, 72.4'; 14" Maple, S20°E, 74.9'; 3" Elm, N45°W, 33.6'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

D-1: 1/4 Cor. Common to Sec. 5, T27N-R6W, Excelsior Township; D-13: Sec. 32, T28N-R6W, Coldsprings Twp, Kalkaska Co.

Found 3/4" iron pipe with cap in centerline State Road East-West, in centerline of seasonal road to North. Pulled & replaced with 5/8" X 18" rebar with brass remon cap.

No G.L.O. witnesses were found.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

D-1: 1/4 Cor. Common to Sec. 5, T27N-R6W, Excelsior Township; D-13: Sec. 32, T28N-R6W, Coldsprings Twp, Kalkaska Co.

Found 3/4" iron pipe with cap in centerline State Road East-West, in centerline of seasonal road to North. Pulled & replaced with 5/8" X 18" rebar with brass remon cap.

N35°E, 62.28', 8" Red Pine, set nail & tag

S59°E, 81.05', power pole, set nail & tag

S11°W, 66.58', 6" Poplar, set nail & tag

N27°W, 33.40', 8" Elm, set nail & tag


Kalkaska County Peer Group accepted the above monument as a careful and faithful reestablishment of the position of the original corner.

Ratified by Peer Group

P.A. 345-1990 Kalkaska County

Chairman

Date

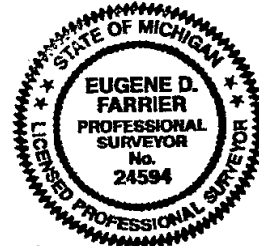

Signed by

Surveyor's Michigan License No. 24594

Date

3026825

Page: 1 of 1

02/15/2001 10:26A

RECON

LB: 8 PG: 154

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
 REVISED MAY 14, 1975
 REVISED JAN., 1993
 REVISED OCT., 1995



Kalkaska County Joan Hall, Register