

3/11/19

L. 407, P. 669

Land Corner Recordation Certificate

Authority: 1970 PA 74, MCL 54.205

Surveyor's Name: Craig W. McVean

Field Survey Date: 01/22/2019

For corner(s) in: Lake County

Original Public Land Survey Corner

Corner Code

S	T	R	
S	T	R	
S	T	R	
S	T	R	

Property Controlling Corner

Corner Code

S	T	R	
S	T	R	
S	T	R	
S	T	R	

Property Corner

Corner Code

S	11	T	19N	R	13W	1
S	11	T	19N	R	13W	4
S		T		R		
S		T		R		

Protracted Public Land Survey Corner

Corner Code

S	T	R	
S	T	R	
S	T	R	
S	T	R	

1	A	B	C	D	E	F	G	H	I	J	K	L	M	1
2	6		5		4		3		2		1		2	
3													3	
4	7		8		9		10		11		12		4	
5													5	
6	18		17		16		15		14		13		6	
7													7	
8	19		20		21		22		23		24		8	
9													9	
10	30		29		28		27		26		25		10	
11													11	
12	31		32		33		34		35		36		12	
13													13	
	A	B	C	D	E	F	G	H	I	J	K	L	M	

Part A: Corner History

1 - W 1/16 Cor. common to Sec. 2 & 11, T19N, R13W
- None

4 - NW 1/16 Cor. Section 11, T19N, R13W

- 1973 - Unrec. Survey - Lakestate Survey & Eng. -
File No. - 1978-73 - C. E. Cole (PS # 17615) - iron
set

L.407, P.670

Part B: Surveyor's Report on Perpetuation, Restoration, Reestablishment, or Monumentation of Corner

1 – W 1/16 Cor. common to Sec. 2 & 11, T19N, R13W –
Found ½" x 18" long rebar with cap # 12016
(Bonney) lying nearly flat at base of uprooted
fallen cedar tree. Iron not in place but near proper
position. Thus removed and set Stamped
2" Aluminum Cap on 5/8" x 4' long iron rebar per
standard BLM procedure. South 35' to N. Bank of
Creek – course SW.


4 – NW 1/16 Cor. Sec. 11, T19N, R13W –
Found ½" capped iron # 17615 with Axle shaft guard
on NE side. Also 2 tires around. ½" CIR accepted
as the best available evidence of the position of the
corner.

Part C: Field Evidence of Perpetuation or Monumentation of Corner


1 – W 1/16 Cor. common to Sec. 2 & 11, T19N, R13W –
Stamped 2" Alum. Cap on 5/8" x 4' long iron rebar.
Set Blue Composite post with Loc. tag 1' NE
N4°E 7.62' to set N & T in W. side 12" Cedar
N62°W 24.80' to set N & T in SW side 24" W. Pine
S79°E 23.89' to set N & T in N. side 11" Cedar
S20°E 10.01' to set N & T in E. side 10" Cedar

4 – NW 1/16 Cor. Sec. 11, T19N, R13W –
½" capped iron #17615
Set Blue Composite Post w/ Loc. tag 1.5' ENE
N53°E 22.48' to set N & T in SE side 21" Oak
S54°E 5.13' to set N & T in NE side 4" Oak
S58°W 11.71' to set N & T in SE side 10" J. Pine
N22°E 12.46' to set N & T in W. side 6' Oak



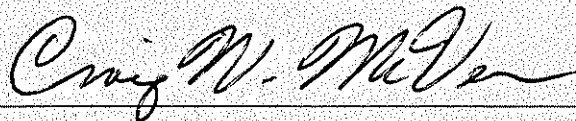

Craig W. McVean

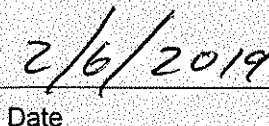

Date

Professional Surveyor's License No.: 39088

Prepared By:
Craig W. McVean
Michigan Dept. of Natural Resources
8015 Mackinaw Trail
Cadillac, Michigan 49601